

RED-D-ARC ***D300K 3+3 SE***

IM10156

August 2013

For use with machines having Code Numbers: **11948**

Red-D-Arc **Welderrentals®**

OPERATOR'S MANUAL

Red-D-Arc Spec-Built Welding Equipment

This **RED-D-ARC** welder is built to **RED-D-ARC Extreme Duty** design specifications by Lincoln Electric.

Safety Depends on You

This welder is designed and built with safety in mind.

However, your overall safety can be increased by proper installation ... and thoughtful operation on your part.

DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT.

And, most importantly, think before you act and be careful.

1-800-245-3660

North America's Largest Fleet of Welding Equipment

! WARNING



CALIFORNIA PROPOSITION 65 WARNINGS



Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm.

The Above For Diesel Engines

The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

The Above For Gasoline Engines

ARC WELDING CAN BE HAZARDOUS. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.



FOR ENGINE powered equipment.

1.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.



1.b. Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



1.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing in contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.

1.d. Keep all equipment safety guards, covers and devices in position and in good repair. Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.

1.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.



1.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.

1.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



1.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



ELECTRIC AND MAGNETIC FIELDS may be dangerous

2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines

2.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.

2.c. Exposure to EMF fields in welding may have other health effects which are now not known.

2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:

2.d.1. Route the electrode and work cables together - Secure them with tape when possible.

2.d.2. Never coil the electrode lead around your body.

2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.

2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.

2.d.5. Do not work next to welding power source.



ELECTRIC SHOCK can kill.

- 3.a. The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.
- 3.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.
- In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:**
- **Semiautomatic DC Constant Voltage (Wire) Welder.**
 - **DC Manual (Stick) Welder.**
 - **AC Welder with Reduced Voltage Control.**
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically “hot”.
- 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 3.g. Never dip the electrode in water for cooling.
- 3.h. Never simultaneously touch electrically “hot” parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 3.j. Also see Items 6.c. and 8.




ARC RAYS can burn.

- 4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87.1 standards.
- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



FUMES AND GASES can be dangerous.

- 5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases. When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep fumes and gases away from the breathing zone. **When welding with electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and within applicable OSHA PEL and ACGIH TLV limits using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.**
5. b. The operation of welding fume control equipment is affected by various factors including proper use and positioning of the equipment, maintenance of the equipment and the specific welding procedure and application involved. Worker exposure level should be checked upon installation and periodically thereafter to be certain it is within applicable OSHA PEL and ACGIH TLV limits.
- 5.c. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 5.d. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.e. Read and understand the manufacturer’s instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer’s safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 5.f. Also see item 1.b.

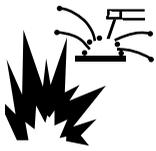


WELDING and CUTTING SPARKS can cause fire or explosion.

6.a. Remove fire hazards from the welding area. If this is not possible, cover them to prevent the welding sparks from starting a fire.

Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near hydraulic lines. Have a fire extinguisher readily available.

- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 6.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.c.
- 6.i. Read and follow NFPA 51B "Standard for Fire Prevention During Welding, Cutting and Other Hot Work", available from NFPA, 1 Batterymarch Park, PO box 9101, Quincy, Ma 022690-9101.
- 6.j. Do not use a welding power source for pipe thawing.

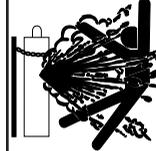

CYLINDER may explode if damaged.

- 7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.
- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
 - Away from areas where they may be struck or subjected to physical damage.
 - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-1, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.



FOR ELECTRICALLY powered equipment.

- 8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

Refer to <http://www.lincolnelectric.com/safety> for additional safety information.

PRÉCAUTIONS DE SÛRETÉ

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté spécifiques qui paraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

Sûreté Pour Soudage A L'Arc

1. Protégez-vous contre la secousse électrique:
 - a. Les circuits à l'électrode et à la pièce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vêtements mouillés. Porter des gants secs et sans trous pour isoler les mains.
 - b. Faire très attention de bien s'isoler de la masse quand on soude dans des endroits humides, ou sur un plancher métallique ou des grilles métalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
 - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état de fonctionnement.
 - d. Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
 - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
 - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces précautions pour le porte-électrode s'appliquent aussi au pistolet de soudage.
2. Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas où on reçoit un choc. Ne jamais enrouler le câble-électrode autour de n'importe quelle partie du corps.
3. Un coup d'arc peut être plus sévère qu'un coup de soliel, donc:
 - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections quand on soude ou quand on regarde l'arc.
 - b. Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
 - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.
5. Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans latéraux dans les zones où l'on pique le laitier.

6. Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
7. Quand on ne soude pas, poser la pince à un endroit isolé de la masse. Un court-circuit accidentel peut provoquer un échauffement et un risque d'incendie.
8. S'assurer que la masse est connectée le plus près possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaînes de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'échauffement des chaînes et des câbles jusqu'à ce qu'ils se rompent.
9. Assurer une ventilation suffisante dans la zone de soudage. Ceci est particulièrement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumées toxiques.
10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistilage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgène (gas fortement toxique) ou autres produits irritants.
11. Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

PRÉCAUTIONS DE SÛRETÉ POUR LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

1. Relier à la terre le châssis du poste conformément au code de l'électricité et aux recommandations du fabricant. Le dispositif de montage ou la pièce à souder doit être branché à une bonne mise à la terre.
2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
3. Avant de faire des travaux à l'intérieur de poste, la débrancher à l'interrupteur à la boîte de fusibles.
4. Garder tous les couvercles et dispositifs de sûreté à leur place.

Thank You — for selecting one of our **QUALITY** products. We want you to take pride in operating this product ... as much pride as we have in bringing this product to you!

CUSTOMER ASSISTANCE POLICY

The business of our company is manufacturing and selling high quality welding equipment. Our challenge is to meet the needs of our customers and to exceed their expectations. On occasion, purchasers may ask us for advice or information about their use of our products. We respond to our customers based on the best information in our possession at that time. We are not in a position to warrant or guarantee such advice, and assume no liability, with respect to such information or advice. We expressly disclaim any warranty of any kind, including any warranty of fitness for any customer's particular purpose, with respect to such information or advice. As a matter of practical consideration, we also cannot assume any responsibility for updating or correcting any such information or advice once it has been given, nor does the provision of information or advice create, expand or alter any warranty with respect to the sale of our products.

We are a responsive manufacturer, but the selection and use of specific products sold by us is solely within the control of, and remains the sole responsibility of the customer. Many variables beyond our control affect the results obtained in applying these types of fabrication methods and service requirements.

Subject to Change – This information is accurate to the best of our knowledge at the time of printing.

Please Examine Carton and Equipment For Damage Immediately

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, Claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Product _____

Model Number _____

Code Number or Date Code (if available) _____

Serial Number (if available) _____

Date Purchased _____

Where Purchased _____

Whenever you request replacement parts or information on this equipment, always supply the information you have recorded above.

Read this Operators Manual completely before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection. The level of seriousness to be applied to each is explained below:

⚠ WARNING

This statement appears where the information **must** be followed **exactly** to avoid **serious personal injury** or **loss of life**.

⚠ CAUTION

This statement appears where the information **must** be followed to avoid **minor personal injury** or **damage to this equipment**.

| | |
|--|---------------------|
| Installation | Section A |
| Technical Specifications | A-1 |
| General Description | A-2 |
| Design Features | A-2 |
| Pre-Operation Installation | A-3 |
| Safety Precautions | A-3 |
| Exhaust Spark Arrester | A-3 |
| Location/Ventilation | A-3 |
| Machine Grounding | A-3 |
| Lift Bail | A-3 |
| Trailers | A-4 |
| Polarity Control and Cable Sizes | A-4 |
| Pre-Operation Service | A-5 |
| Oil | A-5 |
| Fuel, Cooling System | A-5 |
| Battery Charging | A-5 |
| <hr/> | |
| Operation | Section B |
| Engine Operation | B-1 |
| Safety Warnings | B-1 |
| Starting The Kubota Engine | B-1 |
| Stopping the engine | B-1 |
| Break In Period | B-2 |
| Welder Operation | B-2 |
| Duty Cycle | B-2 |
| Control of Welding Current | B-2 |
| Auxiliary Power | B-3 |
| <hr/> | |
| Maintenance | Section D |
| Safety Precautions | D-1 |
| General Instructions | D-1 |
| Cooling System | D-1 |
| Bearings | D-1 |
| Commutator and Brushes | D-1 |
| Slip Rings | D-2 |
| Battery | D-2 |
| Hardware | D-2 |
| Nameplates | D-2 |
| Purging Air from Fuel System | D-2 |
| Engine Service Chart | D-3 |
| GFCI Testing and Resetting Procedure | D-4 |
| <hr/> | |
| Troubleshooting | Section E |
| Safety Precautions | E-1 |
| Welder Troubleshooting | E-2, E-3 |
| Engine Troubleshooting Guide | E-4, E-5 |
| <hr/> | |
| Diagrams | Section F |
| Wiring Diagram | F-1 |
| <hr/> | |
| Parts Lists | P-737 Series |

TECHNICAL SPECIFICATIONS - Red-D-Arc D300K 3+3 SE

| INPUT - ENGINE | | | | | |
|---|---|----------------------------------|---|----------------------------|--|
| Make/Model | Description | Speed (RPM) | Displacement | Starting System | Capacities |
| Kubota D1503-M EPA TIER 4 Compliant | 3 Cylinder 24.8 HP @ (18.5KW) Naturally Aspirated Water Cooled Diesel Engine | High Idle 1800 Full Load 1800 | 91.47 cu. in. (1.56 ltrs) Bore x Stroke 3.27 x 3.64 (83mm x 92mm) | 12VDC Battery | Fuel: 16gal. (60.6L) Oil: 5.9qts. (5.6L) Engine Coolant: 7.82qts. (7.4L) |
| RATED OUTPUT - WELDER | | | | | |
| Welding Output | | Volts at Rated Amps | Duty Cycle¹ | Max. OCV @ 1800 RPM | |
| 300 Amps | | 32 volts | 60% | 90 volts DC | |
| OUTPUT - GENERATOR | | | | | |
| Auxiliary Power ² | | | | | |
| 2400 Watts, 60 Hz 120 Volts AC 100 % Duty Cycle | | | | | |
| PHYSICAL DIMENSIONS | | | | | |
| HEIGHT | WIDTH | DEPTH | WEIGHT | | |
| 45.5 in. | 24.3 in. | 62.8 in. | 1371 lbs. | | |
| 1156 mm | 617 mm | 1595 mm | 622 kg. | | |

LIFT BAIL WEIGHT RATING 2000 LBS. (907KG.) MAXIMUM

1. Duty cycle is based on a 10 minute period. This machine can be loaded to 300 amps for 6 minutes out of every 10 minute period.
2. Output rating in watts is equivalent to volt-amperes at unity power factor. Output voltage is within $\pm 10\%$ at all loads up to rated capacity. When welding, available auxiliary power will be reduced.

GENERAL DESCRIPTION

The D300K 3+3 SE is a heavy duty, engine driven, DC arc welding power source, capable of providing constant current output for stick welding or DC TIG welding. This welder is wound with all copper coils, rated at 300 amps / 32 Volts, and provides other features such as improved door latches and stainless hinges.

The D300K 3+3 SE has Diesel Engine Protection. In the event of sudden low oil pressure or high coolant temperature, the engine immediately shuts down. The D300K 3+3 SE has a current range of 40-325 DC amps.

| RATED OUTPUT | DUTY CYCLE |
|--------------|------------|
| 300A @ 32V | 60% |
| 250A @ 30V | 100% |

This unit is also capable of providing 2400W of 120 volts of 60 hertz AC auxiliary power.

DESIGN FEATURES

Control Panel

The welder controls are located on the upper control panel at the exciter end of the machine. The welder controls consist of a five step "Current Range Selector" switch and a "Fine Current Adjustment" rheostat. The welder is equipped with a "Start" and "Glow Plug" switch for easier cold weather starting and a "Stop" (pull knob), located on the lower control panel at the exciter end of the machine.

The lower control panel contains a battery charging ammeter, GFCI and one circuit breaker for auxiliary power. If a GFCI is tripped, See the MAINTENANCE section for detailed information on testing and resetting the GFCI.

All Copper Windings - For long life and dependable operation.

Auxiliary Power - 2400W of nominal 120V, 60Hz, AC. Output voltage is maintained within $\pm 10\%$ at all loads up to rated capacity.

Welder Enclosure - The complete welder is rubber mounted on a rugged steel "C" channel base.

The output terminals are placed at the side of the machines so that they are protected by the door. The output terminals are labeled (+) and (-).

Cranking System - A 12 volt electric starter is standard.

Air Cleaner - Heavy duty two stage dry type.

Muffler - A muffler and exhaust outlet elbow are standard.

Engine Hour Meter - A meter to record hours of operation.

Engine Protection - The system shuts the engine down in the event of sudden low oil pressure or high coolant temperature.

Fuel Consumption - Fuel consumption has been optimized by means of careful design of the combustion chamber, fuel feed and injection system and cross-flow cylinder heads. In order to enhance longevity of the engine, the engine turns at a constant 1800 RPM and no engine idler is used.

As a result, there is no waiting time for the welder to achieve operating speed when striking an arc.

Fuel consumption figures at average operating loads are as follows:

Tank Capacity:

16 gallons, (60.6L) Plastic Tank.

Fuel Consumption:

| | |
|-------------------|------------------------------|
| High Idle-No Load | 0.35 gallons/hr, (1.33 L/hr) |
| 2400 watts | 0.51 gallons/hr, (1.91 L/hr) |
| 150 Amps@ 26V | 0.60 gallons/hr, (2.28 L/hr) |
| 200 Amps@ 28V | 0.74 gallons/hr, (2.79 L/hr) |
| 250 Amps@ 30V | 0.91 gallons/hr, (3.44 L/hr) |
| 300 Amps@ 32V | 1.12 gallons/hr, (4.23 L/hr) |

Operating Interval:

35 hours per tank

PRE-OPERATION INSTALLATION

⚠ WARNING

Do not attempt to use this equipment until you have thoroughly read the engine manufacturer's manual supplied with your welder. It includes important safety precautions, detailed engine starting, operating and maintenance instructions, and parts lists.



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground
- Always wear dry insulating gloves.



ENGINE EXHAUST can kill.

- Use in open, well ventilated areas or vent exhaust outside.



MOVING PARTS can injure.

- Do not operate with doors open or guards off.
- Stop engine before servicing.
- Keep away from moving parts.

See additional warning information at the front of this operator's manual.

Exhaust Spark Arrester

Some federal, state or local laws may require that engines be equipped with exhaust spark arresters when they are operated in certain locations where unarrested sparks may present a fire hazard. The standard muffler included with this welder does not qualify as a spark arrester. When required by local regulations, a suitable spark arrester must be installed and properly maintained.

⚠ CAUTION

Use of an incorrect arrester may lead to engine damage or performance loss. Contact the engine manufacturer for specific recommendations.

Location / Ventilation

Always operate the welder with the doors closed. Leaving the doors open changes the designed air flow and may cause overheating.

The welder should be located to provide an unrestricted flow of clean, cool air. Also, locate the welder so that engine exhaust fumes are properly vented to an outside area.

Machine Grounding

According to the United States National Electrical Code, the frame of this portable generator is not required to be grounded and is permitted to serve as the grounding means for cord connected equipment plugged into its receptacle.

Some state, local, or other codes or unusual operating circumstances may require the machine frame to be grounded. It is recommended that you determine the extent to which such requirements may apply to your particular situation and follow them explicitly. A machine grounding stud marked with the symbol  is provided on the welding generator frame foot. In general, if the machine is to be grounded, it should be connected with a #8 or larger copper wire to a solid earth ground such as a metal water pipe going into the ground for at least ten feet and having no insulated joints, or to the metal framework of a building which has been effectively grounded. The U.S. National Code lists a number of alternate means of grounding electrical equipment.

Lift Bail

A lift bail is provided for lifting with a hoist.

⚠ WARNING



FALLING EQUIPMENT can cause injury.

- Lift only with equipment of adequate lifting capacity.
- Be sure machine is stable when lifting.
- Do not lift this machine using lift bail if it is equipped with a gas cylinder.
- Do not lift machine if lift bail is damaged.
- Do not operate machine while suspended from lift bail.

DO NOT EXCEED MAXIMUM LIFT BAIL WEIGHT RATING.

(SEE TECHNICAL SPECIFICATIONS PAGE)

Trailer

If the user adapts a trailer, he must assume responsibility that the method of attachment and usage does not result in a safety hazard nor damage the welding equipment. Some of the factors to be considered are as follows:

1. Design capacity of trailer vs. weight of equipment and likely additional attachments.
2. Proper support of, and attachment to, the base of the welding equipment so there will be no undue stress to the framework.
3. Proper placement of the equipment on the trailer to ensure stability side to side and front to back when being moved and when standing by itself while being operated or serviced.
4. Typical conditions of use, i.e., travel speed, roughness of surface on which the trailer will be operated; environmental conditions, likely maintenance.
5. Conformance with federal, state and local laws. ⁽¹⁾
⁽¹⁾ Consult applicable federal, state and local laws regarding specific requirements for use on public highways.

VEHICLE MOUNTING

WARNING

Improperly mounted concentrated loads may cause unstable vehicle handling and tires or other components to fail.

- Only transport this Equipment on serviceable vehicles which are rated and designed for such loads.
- Distribute, balance and secure loads so vehicle is stable under conditions of use.
- Do not exceed maximum rated loads for components such as suspension, axles and tires.
- Mount equipment base to metal bed or frame of vehicle.
- Follow vehicle manufacturer's instructions.

Polarity Control and Cable Sizes

With the engine off, route the electrode and work cables and connect to the studs located below the fuel tank mounting rail. (See size recommendations below.) For **positive** polarity, connect the electrode cable to the terminal marked “+”. For **Negative** polarity, connect the electrode cable to the “-” stud. These connections should be checked periodically and tightened if necessary.

When welding at a considerable distance from the welder, be sure you use ample size welding cables.

| RECOMMENDED COPPER CABLE SIZES | | | |
|--------------------------------|------------|---|----------------|
| Amps | Duty Cycle | Cables Sizes for Combined Length of Electrode Plus Work Cable | |
| | | Up to 200 ft. | 200 to 250 ft. |
| 300 | 60% | 1/0 | 2/0 |
| 250 | 100% | 1 | 1/0 |

PRE-OPERATION SERVICE

⚠ CAUTION

READ the engine operating and maintenance instructions supplied with this machine.

⚠ WARNING



- Stop engine while fueling.
- Do not smoke when fueling.
- Keep sparks and flame away from tank.
- Do not leave unattended while fueling.
- Wipe up spilled fuel and allow fumes to clear before starting engine.
- Do not overfill tank, fuel expansion may cause overflow.

DIESEL FUEL can cause fire.

DIESEL FUEL ONLY-Low sulphur fuel or ultra low sulphur fuel in U.S.A. and Canada.

Oil



This unit is supplied from the factory with the engine crankcase filled with a high quality SAE 10W/30 oil. This oil should be acceptable for most typical ambient temperatures. Consult the engine operation manual for specific engine manufacturer's recommendations. Upon receipt of the welder, check the engine dipstick to be sure the oil is at the "full" mark. DO NOT overfill.

Fuel



Fill the fuel tank with the grade of fuel recommended in the Engine Operator's manual.

Cooling System

The radiator has been filled at the factory with a 50-50 mixture of ethylene glycol antifreeze and water. Check the radiator level and add a 50-50 solution as needed (see engine manual or antifreeze container for alternate antifreeze recommendations).

BATTERY CHARGING

⚠ WARNING



GASES FROM BATTERY can explode.
• Keep sparks, flame and cigarettes away.



BATTERY ACID can burn eyes and skin.
• Wear gloves and eye protection and be careful when boosting, charging or working near battery.

To prevent EXPLOSION when:

- a) Installing a new battery - disconnect the negative cable from the old battery first and connect the negative cable to the new battery last.
- b) Connecting a battery charger - remove the battery from the welder by disconnecting the negative cable first, then the positive cable and battery clamp. When reinstalling, connect the negative cable last.
- c) Using a booster - connect the positive lead to the battery first, then connect the negative lead to the ground lead on the base.

To prevent ELECTRICAL DAMAGE when:

- a) Installing a new battery.
- b) Using a booster.

Use correct polarity - **Negative Ground.**

- To prevent BATTERY DISCHARGE, if you have an ignition switch, turn it off when engine is not running.
- To prevent BATTERY BUCKLING, tighten nuts on battery clamp until snug.

The D300K 3+3 SE is equipped with a wet charged battery. The charging current is automatically regulated when the battery is low (after starting the engine) to a trickle current when the battery is fully charged.

When replacing, jumping or otherwise connecting the battery to the battery cables, the proper polarity must be observed. This system is **NEGATIVE GROUND.**

ENGINE OPERATION

⚠ WARNING

Do not attempt to use this equipment until you have thoroughly read the engine manufacturer’s manual supplied with your welder. It includes important safety precautions, detailed engine starting, operating and maintenance instructions, and parts lists.



- ELECTRIC SHOCK can kill.**
- Do not touch electrically live parts or electrode with skin or wet clothing.
 - Insulate yourself from work and ground
 - Always wear dry insulating gloves.



- ENGINE EXHAUST can kill.**
- Use in open, well ventilated areas or vent exhaust outside.



- MOVING PARTS can injure.**
- Do not operate with doors open or guards off.
 - Stop engine before servicing.
 - Keep away from moving parts.

See additional warning information at the front of this operator’s manual.

Operate the welder with the doors closed. Leaving the doors open changes the designed air flow and can cause overheating.

Starting the D300K 3+3 SE with Kubota Diesel Engine

Refer to the Welder Nameplate for starting instructions.

The D300K 3+3 SE’s engine is equipped with **GLOW PLUGS**. The **GLOW PLUGS** should always be used to help start Kubota diesel engines. Follow the table below for approximate **GLOW PLUG** on times to be used prior to attempted starting:

| Temperature | GLOW PLUGS ON time |
|----------------------------|--------------------|
| Above 10°C (50°F) | No Preheat |
| -5°C (23°F) to 10°C (50°F) | 5.0 sec. |
| Below -5°C (23°F) | 15 sec. |

Limits of continuous use 20 sec.

Note: Extreme cold weather starting may require longer glow plug operation as well as engine oil and coolant heating (using a block heater).

⚠ WARNING

Under **NO** conditions should ether or other starting fluids be used!

Stopping the Engine

1. Pull the “STOP” knob out and hold it out until the engine stops completely.

At the end of each day’s welding, check the crankcase oil level to minimize moisture condensation in the tank. Also, running out of fuel tends to draw dirt into the fuel system.

When hauling the welder between job sites, close the fuel valve on the water separator.

BREAK-IN PERIOD

Lincoln Electric selects high quality, heavy-duty industrial engines for the portable welding machines we offer. While it is normal to see a small amount of crankcase oil consumption during initial operation, excessive oil use, wet stacking (oil or tar like substance at the exhaust port), or excessive smoke is not normal.

Larger machines with a capacity of 350 amperes and higher, which are operated at low or no-load conditions for extended periods of time are especially susceptible to the conditions described above. To accomplish successful engine break-in, most diesel-powered equipment needs only to be run at a reasonably heavy load within the rating of the welder for some period of time during the engine's early life. However, if the welder is subjected to extensive light loading, occasional moderate to heavy loading of the engine may sometimes be necessary. Caution must be observed in correctly loading a diesel/generator unit.

1. Connect the welder output studs to a suitable resistive load bank. Note that any attempt to short the output studs by connecting the welding leads together, direct shorting of the output studs, or connecting the output leads to a length of steel will result in catastrophic damage to the generator and voids the warranty.
2. Set the welder controls for an output current and voltage within the welder rating and duty cycle. Note that any attempt to exceed the welder rating or duty cycle for any period of time will result in catastrophic damage to the generator and voids the warranty.
3. Periodically shut off the engine and check the crankcase oil level.

WELDER OPERATION

⚠ WARNING



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground.



FUMES & GASES can be dangerous.

- Keep your head out of the fumes.
- Use ventilation or exhaust to remove fumes from breathing zone.



WELDING SPARKS can cause fire or explosion.

- Keep flammable material away.



ARC RAYS can burn.

- Wear eye, ear, and body protection.

Duty Cycle

The output rating of the D300K 3+3 SE is 300 amperes at 32 arc volts on a 60% duty cycle. Duty cycle is based on a ten minute period; thus, the welder can be loaded at rated output for six minutes out of every ten minute period.

Control of Welding Current

⚠ CAUTION

DO NOT TURN THE "CURRENT RANGE SELECTOR" WHILE WELDING because the current may arc between the contacts and damage the switch.

The "Current Range Selector" provides five overlapping current ranges. The "Fine Current Adjustment" adjusts the current from minimum to maximum within each range. Open circuit voltage is also controlled by the "Fine Current Adjustment" permitting control of the arc characteristics.

A high open circuit voltage setting provides the soft "buttering" arc with best resistance to pop-outs preferred for most welding. To get this characteristic, set the "Current Range Selector" to the lowest setting that still provides the current you need and set the "Fine Current Adjustment" near maximum. For example: to obtain 175 amps and a soft arc, set the "Current

Range Selector” to the 190-120 position and then adjust the “Fine Current Adjustment” for 175 amps.

When a forceful “digging” arc is required, usually for vertical and overhead welding, use a higher “Current Range Selector” setting and lower open circuit voltage. For example: to obtain 175 amps and a forceful arc, set the “Current Range Selector” to the 240-160 position and the “Fine Current Adjustment” setting to get 175 amps.

Some arc instability may be experienced with EXX10 electrodes when trying to operate with long arc techniques at settings at the lower end of the open circuit voltage range.

CAUTION

DO NOT attempt to set the “Current Range Selector” between the five points designated on the nameplate.

These switches have a spring loaded cam which almost eliminates the possibility of setting this switch between the designated points.

Auxiliary Power

The AC auxiliary power, supplied as standard, has a rating of 2400W of 120 VAC (60 hertz).

With the 2400W, 120 VAC auxiliary power one 120V duplex grounding type receptacle is provided. The circuit is protected with one GFCI with breaker.

The rating of 2400W permits a maximum continuous current of 26 amps that can be drawn from the 120 volt duplex receptacle. The 120 volt duplex receptacle or GFCI has a configuration which permits 20 amps to be drawn from either half. The total combined load of the duplex receptacle or GFCI is not to exceed 2400W.

If a GFCI is tripped, See the MAINTENANCE section for detailed information on testing and resetting the GFCI.

If auxiliary power is used simultaneously with welding, the current which can be used while maintaining voltage regulation within 10% is as follows:

| Welding Current Amps (@ NEMA Arc Volts) | Using 120V Circuit, Amps | Total Auxiliary KVA |
|---|--------------------------|---------------------|
| 0 | 20 | 2.4 |
| 100 | 16 | 1.8 |
| 150 | 15 | 1.7 |
| 200 | 15 | 1.7 |
| 250 | 14 | 1.6 |

SAFETY PRECAUTIONS

⚠ WARNING

Have qualified personnel do the maintenance work. Turn the engine off before working inside the machine. In some cases, it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.

Do not put your hands near any rotating parts. If a problem cannot be corrected by following the instructions, take the machine to the nearest Red-D-Arc location.



ELECTRIC SHOCK can kill.

- Do not touch electrically live parts or electrode with skin or wet clothing.
- Insulate yourself from work and ground
- Always wear dry insulating gloves.



ENGINE EXHAUST can kill.

- Use in open, well ventilated areas or vent exhaust outside.



MOVING PARTS can injure.

- Do not operate with enclosure or guards off.
- Stop engine before servicing.
- Keep away from moving parts.

See additional warning information throughout this operator's manual and the Engine manual as well.

General Instructions

1. Blow out the welder and controls with an air hose at least once every two months. In particularly dirty locations, this cleaning may be necessary once a week. Use low pressure air to avoid driving dirt into the insulation.
2. "Current Range Selector" contacts should not be greased. To keep the contacts clean, rotate the current control through its entire range frequently. Good practice is to turn the handle from maximum to minimum setting twice each morning before starting to weld.
3. Put a drop of oil on the "Current Range Selector" shaft at least once every month.

4. Follow the engine service schedule in this manual and the detailed maintenance and troubleshooting in the engine manufacturer's manual.

Cooling System

The D300K 3+3 SE is equipped with a pressure radiator. Keep the radiator cap tight to prevent loss of coolant. Clean and flush the cooling system periodically to prevent clogging the passage and overheating the engine. When antifreeze is needed, always use the permanent type.

Bearings

This welder is equipped with a double-shielded ball bearing having sufficient grease to last indefinitely under normal service.

Commutator and Brushes

⚠ WARNING

Uncovered rotating equipment can be dangerous. Use care so your hands, hair, clothing or tools do not catch in the rotating parts. Protect yourself from particles that may be thrown out by the rotating armature when stoning the commutator.

Shifting of the commutator brushes may result in:

- Change in machine output
- Commutator damage
- Excessive brush wear

Periodically inspect the commutator, slip rings, and brushes by removing the covers. DO NOT remove or replace these covers while the machine is running. Commutators and slip rings require little attention. However, if they are black or appear uneven, have them cleaned by an experienced maintenance man using fine sandpaper or a commutator stone. Never use emery cloth or paper for this purpose.

Replace brushes when they wear within 1/4" of the pigtail. A complete set of replacement brushes should be kept on hand.

Have an experienced maintenance man seat these brushes by lightly stoning the commutator as the armature rotates at full speed until contact is made across the full face of the brushes. After stoning, blow out the dust with low pressure air.

Arcing or excessive exciter brush wear indicates a possible misaligned shaft. Have an authorized Service Shop check and realign the shaft.

Slip Rings

A slight amount of darkening and wear of the slip rings and brushes is normal. Brushes should be inspected when a general overhaul is necessary. If brushes are to be replaced, clean slip rings with a fine emery paper.

CAUTION

Do not attempt to polish slip rings while engine is running.

To seat slip ring brushes, position the brushes in place. Then slide one end of a piece of fine sandpaper between slip rings and brushes with the coarse side against the brushes. With slight additional finger pressure on top of the brushes, pull the sandpaper around the circumference of the rings - in direction of rotation only - until brushes seat properly. In addition, stone slip ring with a fine stone. Brushes must be seated 100%.

Battery

WARNING



GASES FROM BATTERY can explode.

- Keep sparks, flame and cigarettes away from battery.



To prevent EXPLOSION when:

- **INSTALLING A NEW BATTERY** - disconnect negative cable from old battery first and connect to new battery last.
- **CONNECTING A BATTERY CHARGER** - Remove battery from welder by disconnecting negative cable first, then positive cable and battery clamp. When reinstalling, connect negative cable last. Keep well ventilated.
- **USING A BOOSTER** - connect positive lead to battery first then connect negative lead to engine foot.



BATTERY ACID CAN BURN EYES AND SKIN.

- Wear gloves and eye protection and be careful when working near battery. Follow instructions printed on battery.

1. When replacing, jumping, or otherwise connecting the battery to the battery cables, the proper polarity must be observed. Failure to observe the proper polarity could result in damage to the charging circuit. The positive (+) battery cable has a red terminal cover.
2. If the battery requires charging from an external charger, disconnect the negative battery cable first and then the positive battery cable before attaching the charger leads. Failure to do so can result in damage to the internal charger components. When re-connecting the cables, connect the positive cable first and the negative cable last.

Hardware

Both English and Metric fasteners are used in this welder.

Nameplates

Whenever routine maintenance is performed on this machine - or at least yearly - inspect all nameplates and labels for legibility. Replace those which are no longer clear. Refer to the parts list for the replacement item number.

ENGINE SERVICE

| | | | | | | |
|------------------------------|---|---|---|---|---|---|
| EVERY DAY OR EVERY 8 HOURS | | | | | | |
| FIRST SERVICE (50 HOURS) | | | | | | |
| EVERY 100 HOURS OR 3 MONTHS | | | | | | |
| EVERY 150 HOURS OR 4 MONTHS | | | | | | |
| EVERY 200 HOURS OR 9 MONTHS | | | | | | |
| EVERY 400 HOURS OR 12 MONTHS | | | | | | |
| EVERY 500 HOURS OR 15 MONTHS | | | | | | |
| EVERY 800 HOURS OR 24 MONTHS | | | | | | |
| ENGINE SERVICE (NOTE 2) | | | | | | |
| | | | | | | MAINTENANCE ITEM |
| | | | | | | TYPE OR QUANTITY |
| I | | | | | | Coolant level |
| | | | | I | | Concentration of antifreeze |
| | | | | | R | Coolant (NOTE 3) |
| | | | | | | 50/50 Water/Ethylene Glycol |
| | | | | | | 7.82 qrts., 7.4 L |
| I | | | | | | Engine oil level (NOTE 1) |
| | R | | R | | | Engine oil (NOTE 1 & 3) |
| | | | | | | 5.9 qrts., 5.6 L (including filter) |
| | R | | | R | | Engine oil filter |
| | | | | | | Kubota #HH164-32430 |
| | | C | | | | Drain water separator & fuel strainer |
| | | | | R | | Fuel filter canister |
| | | | | | | Kubota #15221-43170 |
| | | C | | | | Fuel pre-filter element |
| | | | | | | Kubota #15831-43353 |
| | | I | | | | Tension of alternator drive belt |
| | | I | | | | Alternator drive belt wear |
| | | | | | R | Alternator drive belt |
| | | | | | | Kubota # 17480-97010 |
| | | C | | | | Air filter (earlier check may be req'd) |
| | | | | R | | Air filter element |
| | | | | | | Donaldson # P821575 |
| | | | | | I | Valve clearances |
| | | | | | | Intake .0071"-.0086", Exhaust .0071"-.0086" |
| | | | | | I | Electrical systems |
| | | | | | I | All nuts and bolts for tightness |
| I | | | | | | Leaks or engine damage |
| | | I | | | | Battery |

I = Inspect C = Clean R = Replace

Notes:

- (1) Consult Engine Operators Manual for oil recommendations.
- (2) Consult Engine Operators Manual for additional maintenance schedule information.
- (3) Fill slowly! Ensure correct quantity is used.

Above operations to be carried out by trained personnel with reference to the workshop manual where necessary. These preventive maintenance periods apply to average conditions of operation. If necessary use shorter periods.

S29892

GFCI TESTING AND RESETTING PROCEDURE

The GFCI should be properly tested at least once every month or whenever it is tripped. To properly test and reset the GFCI:

- If the GFCI has tripped, first carefully remove any load and check it for damage.
- If the equipment has been shut down, it must be restarted.
- The equipment needs to be operating at high idle speed and any necessary adjustments made on the control panel so that the equipment is providing at least 80 volts to the receptacle input terminals.
- The circuit breaker for this receptacle must not be tripped. Reset if necessary.
- Push the "Reset" button located on the GFCI. This will assure normal GFCI operation.
- Plug a night-light (with an "ON/OFF" switch) or other product (such as a lamp) into the Duplex receptacle and turn the product "ON".
- Push the "Test" button located on the GFCI. The night-light or other product should go "OFF".
- Push the "Reset" button, again. The light or other product should go "ON" again.

If the light or other product remains "ON" when the "Test" button is pushed, the GFCI is not working properly or has been incorrectly installed (miswired). If your GFCI is not working properly, contact a qualified, certified electrician who can assess the situation, rewire the GFCI if necessary or replace the device.

HOW TO USE TROUBLESHOOTING GUIDE

WARNING

Service and Repair should only be performed by Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

Step 1. LOCATE PROBLEM (SYMPTOM).

Look under the column labeled "PROBLEM (SYMPTOMS)". This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting.

Step 2. POSSIBLE CAUSE.

The second column labeled "POSSIBLE CAUSE" lists the obvious external possibilities that may contribute to the machine symptom.

Step 3. RECOMMENDED COURSE OF ACTION

This column provides a course of action for the Possible Cause, generally it states to contact your local Authorized Field Service Facility.

If you do not understand or are unable to perform the Recommended Course of Action safely, contact your local Authorized Field Service Facility.

WARNING

Have qualified personnel do the troubleshooting work. Turn the engine off before working inside the machine. In some cases, it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.

Do not put your hands near the engine cooling blower fan. If a problem cannot be corrected by following the instructions, take the machine to the nearest Local Authorized Field Service Shop.

CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

WELDER TROUBLESHOOTING

| PROBLEMS (SYMPTOMS) | POSSIBLE CAUSE | RECOMMENDED COURSE OF ACTION |
|--|--|--|
| Machine fails to hold the heat consistently. | <ol style="list-style-type: none"> 1. Rough or dirty commutator. Commutator should be turned or cleaned. 2. Brushes may be worn down to limit. Replace brushes. 3. Field circuit may have variable resistance connection or intermittent open circuit due to loose connection or broken wire. Check field current with ammeter to discover varying current. This applies to both the main generator and exciter. 4. Electrode lead or work lead connection may be poor. Tighten all connections. 5. Wrong grade of brushes may have been installed on generator. Use proper brushes. 6. Field rheostat may be making poor contact and overheating. Inspect and clean the rheostat. | <p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Authorized Field Service Facility.</p> |
| Welder starts but fails to generate current. | <ol style="list-style-type: none"> 1. Generator or exciter brushes may be loose or missing. Be sure that all brushes bear on the commutator and have proper spring tension. 2. Exciter may not be operating. Check exciter output voltage with voltmeter or lamp. 3. Field circuit of generator or exciter may be open. Check for open circuits in rheostat, field leads, and field coils. Check rectifier bridge and fuses. 4. Exciter may have lost excitation. Flash fields. 5. Series field and armature circuit may be open-circuited. Check circuit with ringer or voltmeter. | |
| | | |

⚠ CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

WELDER TROUBLESHOOTING

- (1) FLASHING THE FIELDS:
1. Stop the engine welder and remove the cover from the exciter.
 2. Turn the "Fine Current Adjustment" (rheostat) to "100" on the dial.
 3. Using a 12 volt automotive battery, connect it's negative terminal to the negative brush holder. The negative brush holder is the one nearest to the rotor lamination. See the wiring diagram. With the engine NOT running, touch the positive battery terminal to the positive brush holder. Remove the battery from the circuit.
 4. Replace the exciter cover. Start the welder and the generator voltage should build up.

| PROBLEMS (SYMPTOMS) | POSSIBLE CAUSE | RECOMMENDED COURSE OF ACTION |
|--|--|--|
| Welding arc is loud and spatters excessively. | <ol style="list-style-type: none"> 1. Current setting may be too high. Check setting and current output with ammeter. 2. Polarity may be wrong. Check polarity. Try reversing polarity or try an electrode of the opposite polarity. | <p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Authorized Field Service Facility.</p> |
| Welding current too great or too small compared to indication on the dial. | <ol style="list-style-type: none"> 1. Exciter output low causing low output compared to indication. Check exciter field circuit. 2. Operating speed too low or too high. | |
| Arc continuously pops out. | <ol style="list-style-type: none"> 1. "Current Range Selector" switch may be set at an intermediate position. | |
| | | |

CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

D300K 3+3 SE
Red-D-Arc
Welderrentals.

Observe all Safety Guidelines detailed throughout this manual

ENGINE TROUBLESHOOTING

| PROBLEMS (SYMPTOMS) | POSSIBLE CAUSE | RECOMMENDED COURSE OF ACTION |
|----------------------------------|---|--|
| Engine does not start. | <ol style="list-style-type: none"> 1. Faulty Ignition switch and or Injector pump solenoid. Correct the connection and contact. 2. Insufficient charging or complete discharge of the battery. Charge. 3. Lack of fuel. Supply fuel. 4. Air mixed in the fuel system. 5. Clogged fuel filter. Replace. 6. Irregular and faulty fuel supply (Injector pump trouble). Repair in an authorized field service shop. 7. Glow plug not heated. Breakage of the glow plug; replace. 8. Improper viscosity of the lubricating oil. Inspect and replace. 9. Clogged air cleaner. Clean or replace. 10. No compression. Repair in a field service shop. | <p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Authorized Field Service Facility.</p> |
| Irregular running of the engine. | <ol style="list-style-type: none"> 1. Air mixed in the fuel system. 2. Uneven fuel injection (Faulty fuel injector pump). Repair in an authorized field service shop. 3. Clogged fuel filter. Replace. 4. Defective governor. Check and correct. 5. Engine itself defective. Repair in an authorized field service shop. | |
| | | |

 **CAUTION**

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

ENGINE TROUBLESHOOTING

| PROBLEMS (SYMPTOMS) | POSSIBLE CAUSE | RECOMMENDED COURSE OF ACTION |
|--------------------------------|--|--|
| Engine stops during operation. | <ol style="list-style-type: none"> 1. Lack of fuel in the fuel tank. Supply fuel. 2. Clogged fuel filter. Replace. 3. Air mixed in the fuel system. 4. Faulty function of the engine. Repair in a service shop. | <p>If all recommended possible areas of misadjustment have been checked and the problem persists, Contact your local Authorized Field Service Facility.</p> |
| (White or Blue) Smoke. | <ol style="list-style-type: none"> 1. Excess engine oil. Inspect and correct the level. 2. Too low viscosity of the engine oil. Inspect and replace the oil with proper grade. 3. Faulty injection timing. Repair in a service shop. | |
| Dark Grey Smoke. | <ol style="list-style-type: none"> 1. Unsuitable fuel. Inspect and replace with correct grade. 2. Excess injection. Inspect and adjust (in a field service shop). 3. Faulty function of the engine. Repair in a field service shop. 4. Overloading. Reduce the load. 5. Clogged air cleaner. Clean. | |
| Faulty Charging. | <ol style="list-style-type: none"> 1. Loose fan belt. Correct the tension. 2. Faulty wiring. Inspect and correct. 3. Faulty battery. Repair. 4. Worn out alternator brush. Replace. | |
| Starter Motor does not run. | <ol style="list-style-type: none"> 1. Loose or damaged wiring. Inspect and tighten. 2. Dropped voltage of the battery. Charge the battery. 3. Damaged starter motor (including solenoid). Repair in a field service shop. | |

CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

NOTES

PARTS LIST FOR

D300K 3+3 SE KUBOTA

**Red-D-Arc
Welderrentals®**

This parts list is provided as an informative guide only.


It was accurate at the time of printing. These pages are only updated on the Service Navigator DVD and in Lincoln Electric's official Parts Book (BK-34).

When ordering parts, always refer to Lincoln Electric's official Parts Book (BK-34) for the latest pages.


D300K 3+3 SE KUBOTA

**Red-D-Arc
Welderrentals.**

ILLUSTRATION OF SUB-ASSEMBLIES

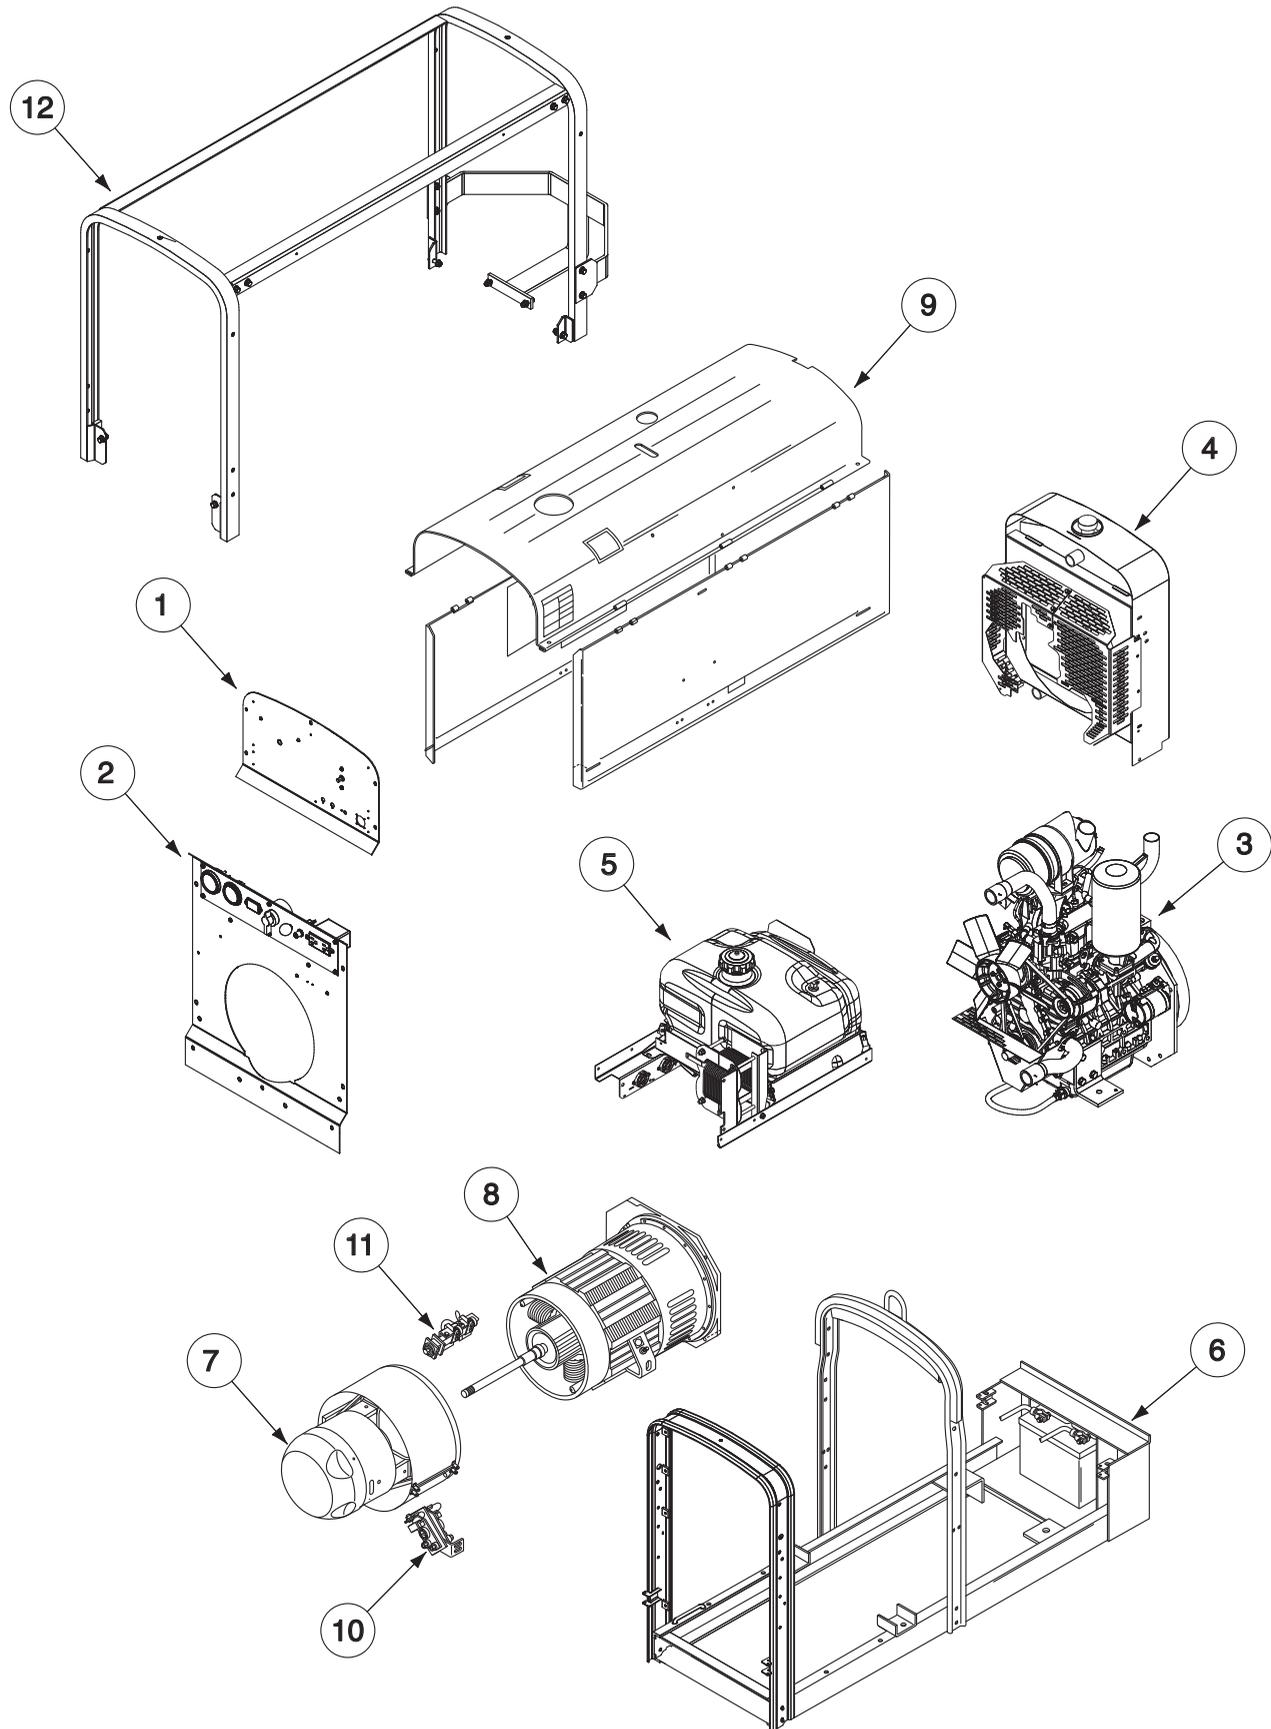

Upper Control Panel Assembly

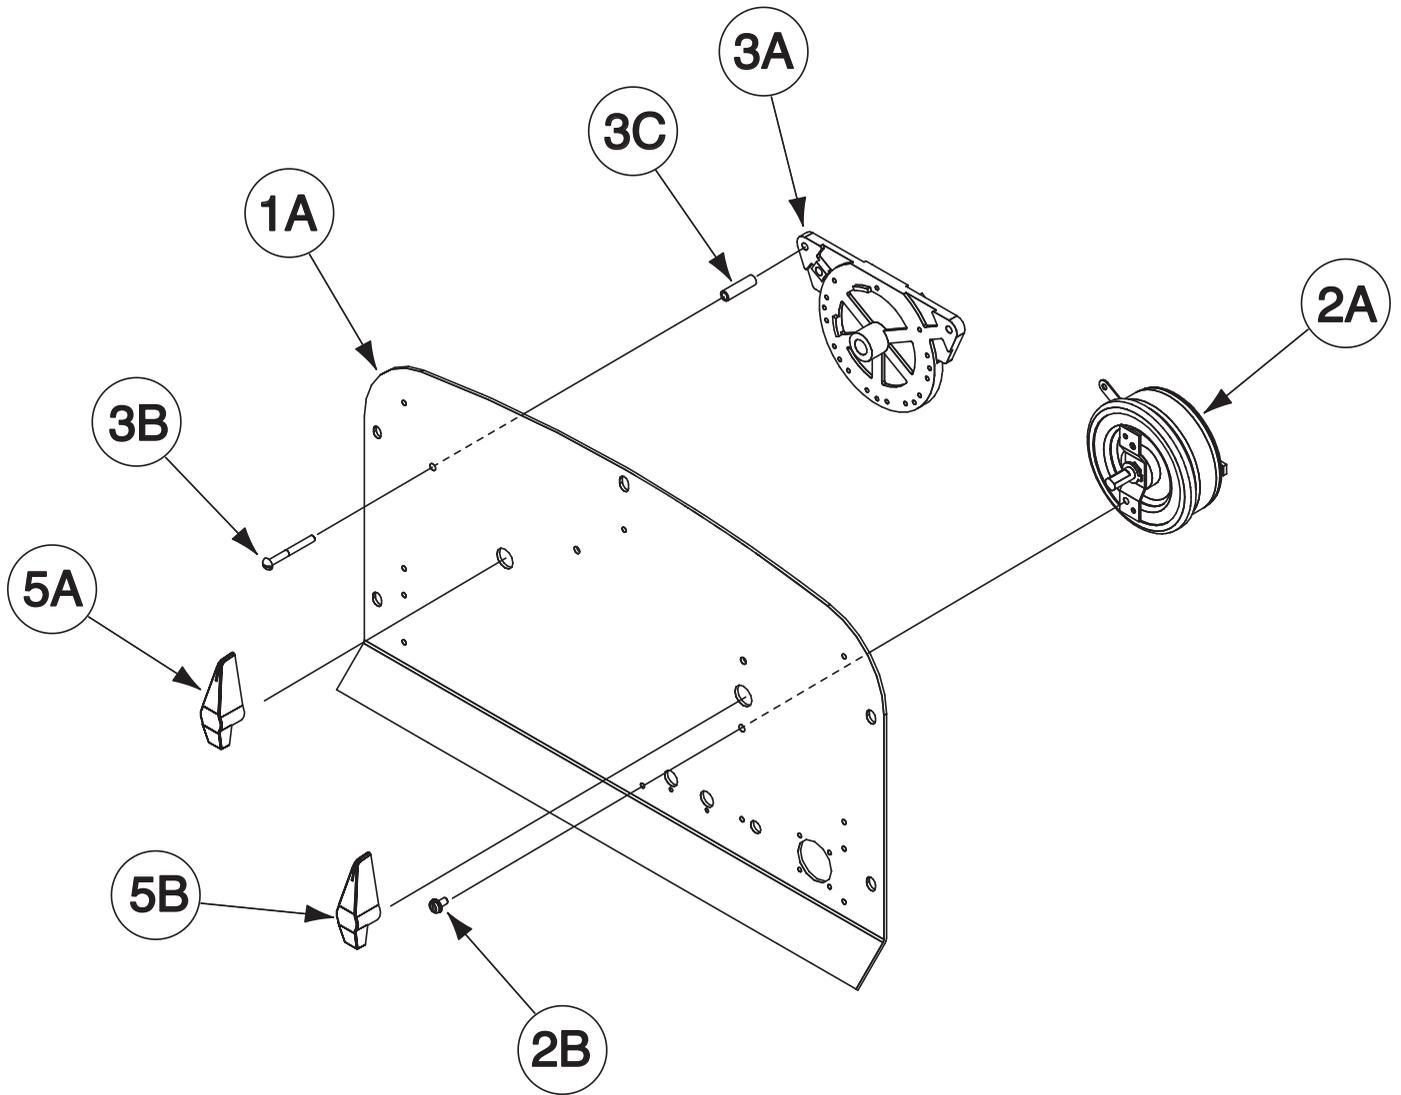


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|---|-----------|------|---|---|---|---|---|---|---|---|---|
| 1 | Upper Control Panel Assembly, Includes: | M24976 | 1 | X | | | | | | | | |
| 1A | Upper Control Panel | M24975 | 1 | X | | | | | | | | |
| 2A | Rheostat | M5090-C | 1 | X | | | | | | | | |
| 2B | Sems Screw | T10082-4 | 2 | X | | | | | | | | |
| 2C | #8-32 x .50 RHS (BR) (Not Shown) | CF000102 | 2 | X | | | | | | | | |
| 2D | Lock Washer (Not Shown) | T9695-3 | 2 | X | | | | | | | | |
| 2E | #8-32 BR HN (Not Shown) | CF000103 | 4 | X | | | | | | | | |
| 3A | Selector Switch Assembly | M13335 | 1 | X | | | | | | | | |
| 3B | #10-24 x 1.75 RHS | CF000127 | 2 | X | | | | | | | | |
| 3C | Spacer | S10918-60 | 2 | X | | | | | | | | |
| 3D | Plain Washer (Not Shown) | S9262-27 | 2 | X | | | | | | | | |
| 3E | Lock Washer (Not Shown) | T9695-1 | 2 | X | | | | | | | | |
| 3F | #10-24 HN (Not Shown) | CF000010 | 2 | X | | | | | | | | |
| 4A | Upper Nameplate (Not Shown) | L16338 | 1 | X | | | | | | | | |
| 4B | Self Tapping Screw (Not Shown) | S8025-92 | 8 | X | | | | | | | | |
| 5A | Control Handle (Selector Switch) | M13989-1 | 1 | X | | | | | | | | |
| 5B | Control Handle (Rheostat) | S16664-13 | 1 | X | | | | | | | | |

Lower Control Panel Assembly


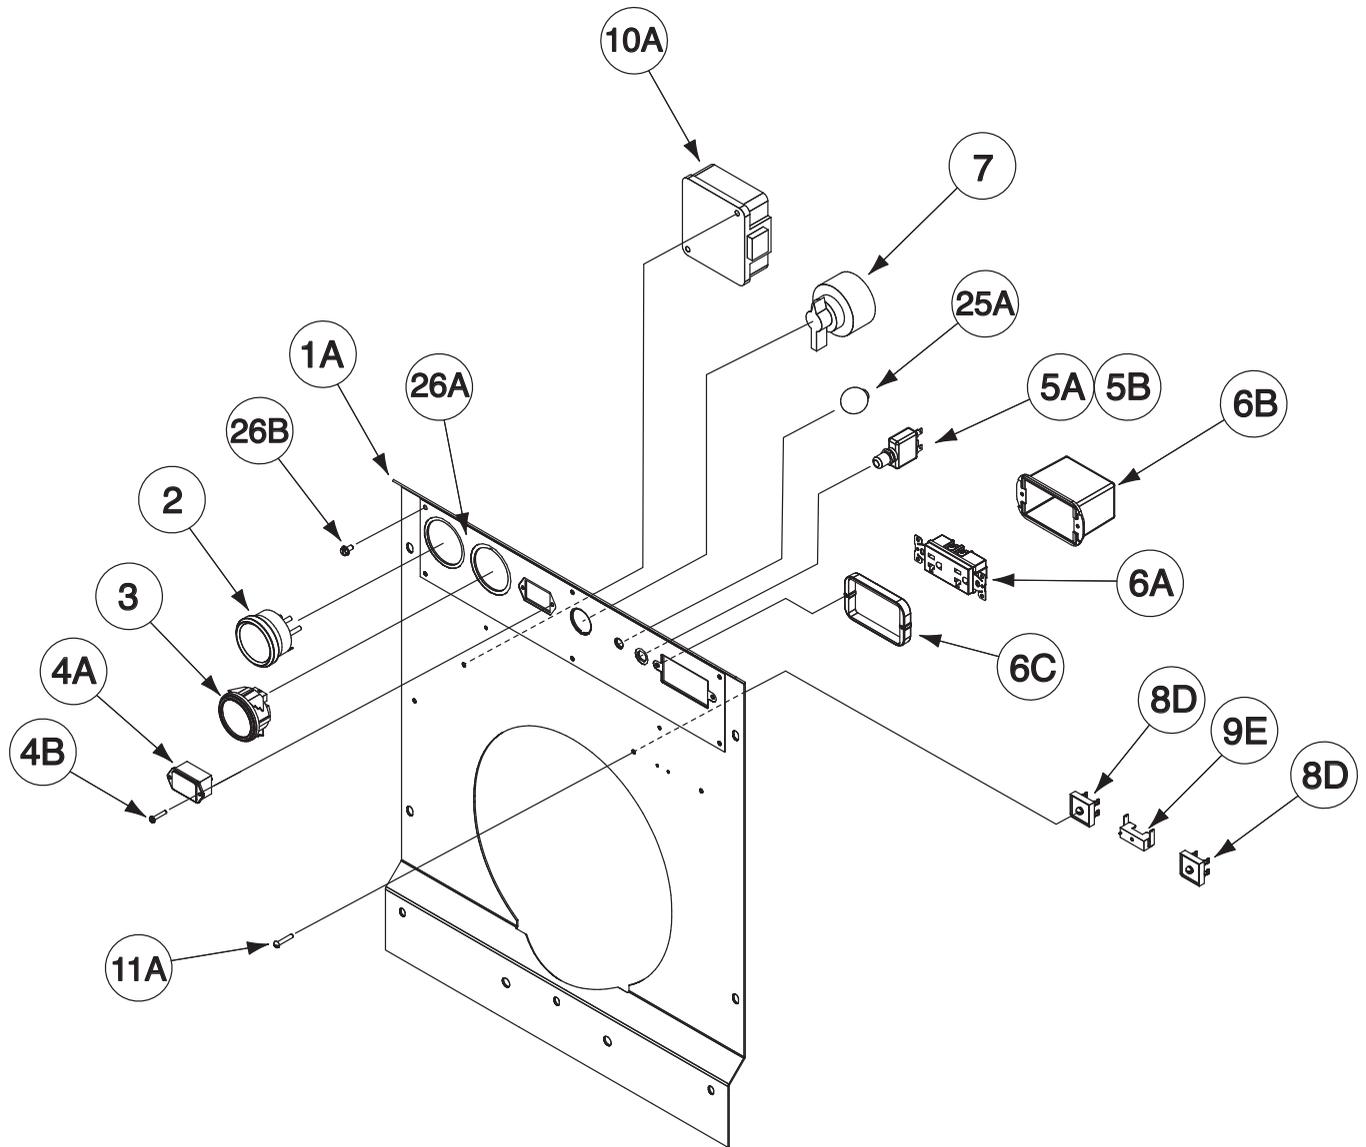


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|--|-----------|------|---|---|---|---|---|---|---|---|---|
| 1 | Lower Control Panel Assembly, Includes: | G7548 | 1 | X | | | | | | | | |
| 1A | Lower Control Panel | L16337 | 1 | X | | | | | | | | |
| 2 | Ammeter | S7514-7 | 1 | X | | | | | | | | |
| 3 | Water Temperature Gauge | S25154-2 | 1 | X | | | | | | | | |
| 4A | Hour Meter | S17475-6 | 1 | X | | | | | | | | |
| 4B | #6-32 x .75 PPNHS | S18825-1 | 2 | X | | | | | | | | |
| 4C | Lock Washer (Not Shown) | T9695-2 | 2 | X | | | | | | | | |
| 4D | #6-32 HN (Not Shown) | CF000005 | 2 | X | | | | | | | | |
| 5A | Circuit Breaker (20A, 250VAC) | T12287-31 | 1 | X | | | | | | | | |
| 5B | Sealing Boot | S22061-1 | 1 | X | | | | | | | | |
| 6A | GFCI Receptacle (115V) | S24410 | 1 | X | | | | | | | | |
| 6B | GFCI Cover | L13286 | 1 | X | | | | | | | | |
| 6C | Mounting Bracket | S27167 | 1 | X | | | | | | | | |
| 6D | Thermoplastic Screw (Not Shown) | S24738-3 | 2 | X | | | | | | | | |
| 6E | Receptacle Cover (Not Shown) | M16996 | 1 | X | | | | | | | | |
| 7 | Start Switch & Handle | S29921 | 1 | X | | | | | | | | |
| 8A | #8-32 HN (Not Shown) | CF000042 | 2 | X | | | | | | | | |
| 8B | #8-32 x .875 RHS (Not Shown) | CF000059 | 2 | X | | | | | | | | |
| 8C | Plain Washer (Not Shown) | S9262-3 | 2 | X | | | | | | | | |
| 8D | Diode Bridge (35A, 800V) | T13637-5 | 2 | X | | | | | | | | |
| 8E | Lock Washer (Not Shown) | T4291-A | 2 | X | | | | | | | | |
| 9A | #4-40 x .375 RHS (Not Shown) | CF000001 | 1 | X | | | | | | | | |
| 9B | #4-40 HN (Not Shown) | CF000002 | 1 | X | | | | | | | | |
| 9C | Plain Washer (Not Shown) | S9262-39 | 1 | X | | | | | | | | |
| 9D | Fuse (15A, 250V) (Not Shown) | T10728-8 | 1 | X | | | | | | | | |
| 9E | Fuse Holder | T15011-1 | 1 | X | | | | | | | | |
| 9F | Lock Washer (Not Shown) | T4291-B | 1 | X | | | | | | | | |
| 10A | Engine Control Unit (Supplied w/Engine) | * | 1 | X | | | | | | | | |
| 10B | E10-24 x 2.75 HHCS (Not Shown) | CF000049 | 2 | X | | | | | | | | |
| 10C | Spacer (Not Shown) | S10918-69 | 2 | X | | | | | | | | |
| 10D | Plain Washer (Not Shown) | S9262-27 | 2 | X | | | | | | | | |
| 10E | Lock Washer (Not Shown) | T9695-1 | 2 | X | | | | | | | | |
| 10F | #10-24 HN (Not Shown) | CF000010 | 2 | X | | | | | | | | |
| 11A | Ground Screw | S9225-36 | 2 | X | | | | | | | | |
| 11B | Lock Washer (Not Shown) | T9695-1 | 2 | X | | | | | | | | |
| 11C | #10-24 HN (Not Shown) | CF000010 | 4 | X | | | | | | | | |
| 18 | MOV (Not Shown) | S28445 | 1 | X | | | | | | | | |
| 25A | Knob | T10889 | 1 | X | | | | | | | | |
| 25B | Bushing (Not Shown) | T12380-6 | 1 | X | | | | | | | | |
| 26A | Nameplate | L16339 | 1 | X | | | | | | | | |
| 26B | Self Tapping Screw | S8025-92 | 6 | X | | | | | | | | |
| 27 | Guard (Not Shown) (Mounts to Case Front Output Rail) | M24953 | 1 | X | | | | | | | | |
| 28 | Guard (Not Shown) (Mounts to Case Front- Fuel Tank Rail) | M24952 | 1 | X | | | | | | | | |

Engine Assembly

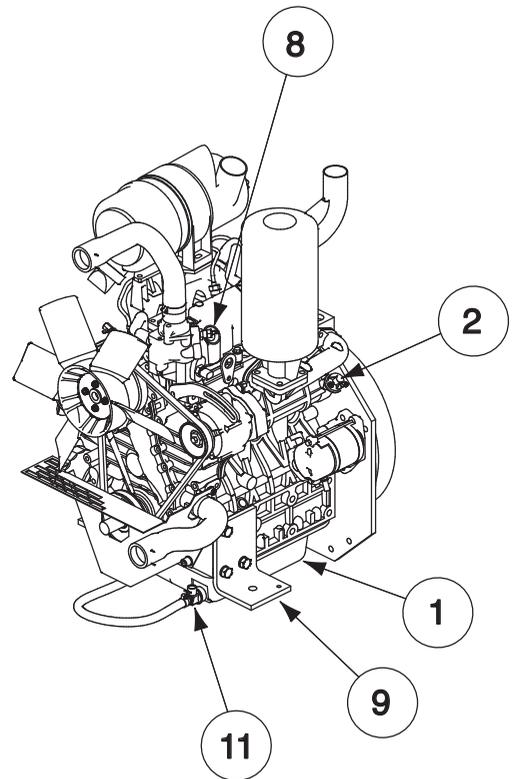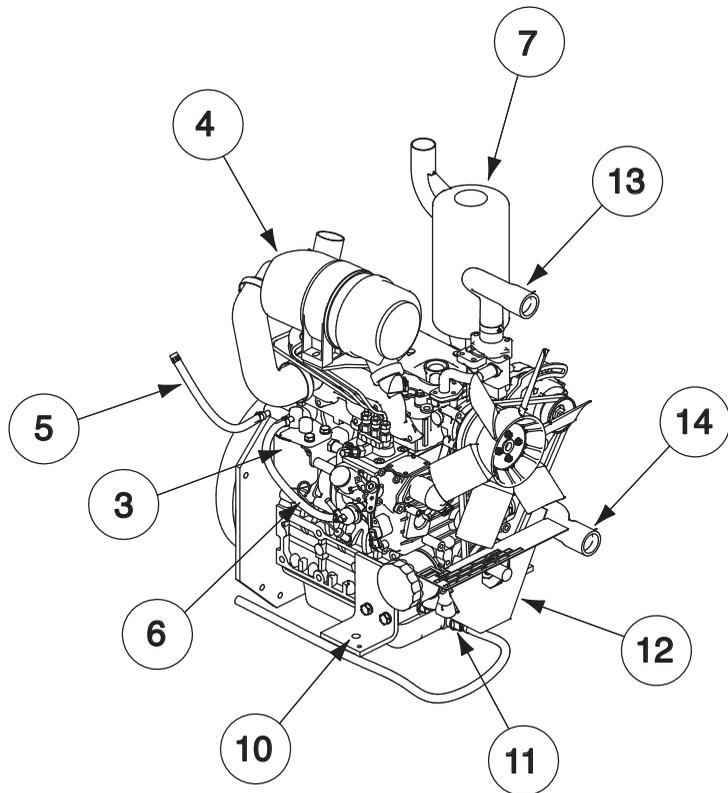

Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|-----------|--|------------|------|---|---|---|---|---|---|---|---|---|
| 1 | Engine Assembly (L16260-1), Includes: Engine (M24643) | NSS | 1 | X | | | | | | | | |
| | | NSS | 1 | X | | | | | | | | |
| 2 | Oil Pressure Switch/Sender Pipe Adapter | S14446 | 1 | X | | | | | | | | |
| | | S25853 | 1 | X | | | | | | | | |
| 3 | Fuel Filter (Supplied w/Engine) Fuel Filter Bracket 3/8 x 1.25 HHB 3/8-16 HN Lock Washer | * | 1 | X | | | | | | | | |
| | | S29927 | 1 | X | | | | | | | | |
| | | CF000105 | 2 | X | | | | | | | | |
| | | CF000067 | 2 | X | | | | | | | | |
| | | E106A-16 | 2 | X | | | | | | | | |
| 4 | Air Cleaner Bracket M8-1.25 x 20mm HHS w/Lock Washer (Supplied w/Engine) Plain Washer Air Filter Mounting Band Air Filter 5/16-18 x 1.25 HHCS 5/16-18 HN Lock Washer Plain Washer Air Intake Hose Hose Clamp | M24648 | 1 | X | | | | | | | | |
| | | * | 2 | X | | | | | | | | |
| | | S9262-120 | 2 | X | | | | | | | | |
| | | M20359 | 1 | X | | | | | | | | |
| | | M20358 | 1 | X | | | | | | | | |
| | | CF000028 | 2 | X | | | | | | | | |
| | | CF000029 | 2 | X | | | | | | | | |
| | | E106A-3 | 2 | X | | | | | | | | |
| | | S9262-121 | 4 | X | | | | | | | | |
| | | M20357 | 1 | X | | | | | | | | |
| S10888-33 | 2 | X | | | | | | | | | | |
| 5 | Flex Tube (Fuel Separator to Fuel Filter) Hose Clamp | T10642-86 | 1 | X | | | | | | | | |
| | | T13777-1 | 2 | X | | | | | | | | |
| 6 | Flex Tube (Fuel Filter to Pump) Hose Clamp | T10642-269 | 1 | X | | | | | | | | |
| | | T13777-1 | 2 | X | | | | | | | | |
| 7 | Muffler Gasket (Supplied w/Engine) M8-1.25 x 25mm HHS w/Lock Washer (Supplied w/Engine) | L16574 | 1 | X | | | | | | | | |
| | | * | 1 | X | | | | | | | | |
| | | * | 4 | X | | | | | | | | |
| 8 | Temperature Sensor Bushing | S27248 | 1 | X | | | | | | | | |
| | | S27286 | 1 | X | | | | | | | | |
| 9 | Engine Mounting Foot (Left) Plain Washer M12-1.25 x 35mm HHS (Supplied w/Engine) M12 Lock Washer (Supplied w/Engine) | M20367-1 | 1 | X | | | | | | | | |
| | | S9262-80 | 3 | X | | | | | | | | |
| | | * | 3 | X | | | | | | | | |
| | | * | 3 | X | | | | | | | | |
| 10 | Engine Mounting Foot (Right) Plain Washer M12-1.25 x 35mm HHS (Supplied w/Engine) M12 Lock Washer (Supplied w/Engine) | M20367-2 | 1 | X | | | | | | | | |
| | | S9262-80 | 3 | X | | | | | | | | |
| | | * | 3 | X | | | | | | | | |
| | | * | 3 | X | | | | | | | | |
| 11 | Oil Drain Valve Flex Hose Clamp | S23024-2 | 1 | X | | | | | | | | |
| | | T10642-350 | 1 | X | | | | | | | | |
| | | S10888-27 | 1 | X | | | | | | | | |
| 12 | Lower Guard M10-1.25 x 25mm SHCS M10 Lock Washer M8-1.25 x 20mm SCHS Lock Washer | L13687 | 1 | X | | | | | | | | |
| | | T14731-49 | 2 | X | | | | | | | | |
| | | S17400-1 | 2 | X | | | | | | | | |
| | | T14731-3 | 1 | X | | | | | | | | |
| | | E106A-3 | 1 | X | | | | | | | | |
| 13 | Upper Radiator Hose Hose Clamp Hose Clamp | L12244 | 1 | X | | | | | | | | |
| | | S10888-44 | 1 | X | | | | | | | | |
| | | S10888-8 | 1 | X | | | | | | | | |
| 14 | Lower Radiator Hose Hose Clamp Hose Clamp | L122445 | 1 | X | | | | | | | | |
| | | S10888-44 | 1 | X | | | | | | | | |
| | | S10888-8 | 1 | X | | | | | | | | |

NSS - Not Sold Separately


D300K 3+3 SE KUBOTA

Oct-13

* Contact Engine Manufacturer

Red-D-Arc
Welderrentals.

Radiator Assembly

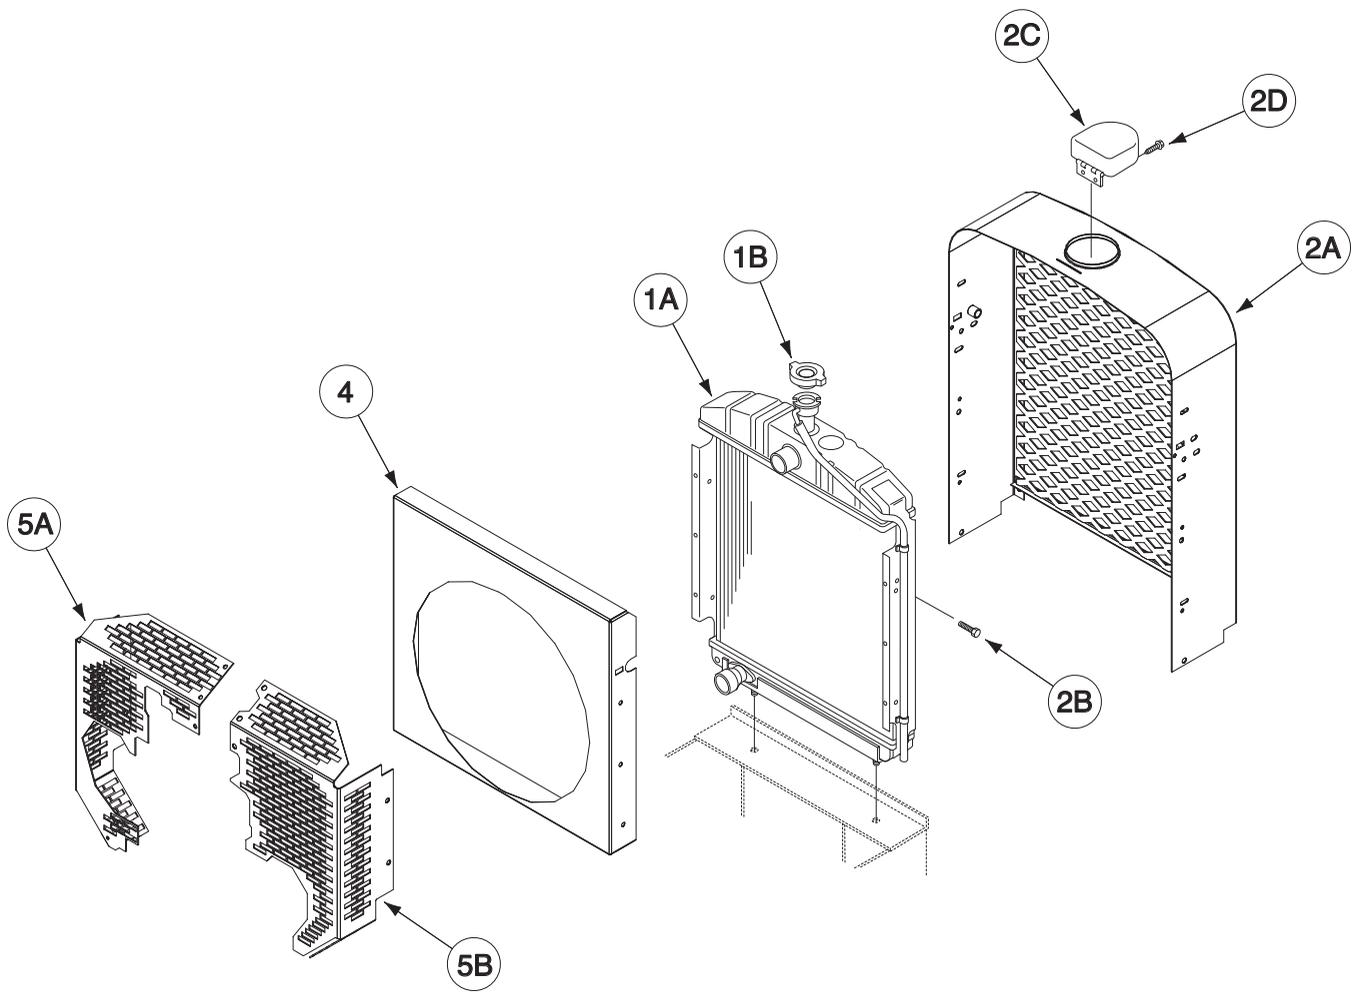


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|-----------------------------|----------|------|---|---|---|---|---|---|---|---|---|
| 1A | Radiator | G3432 | 1 | X | | | | | | | | |
| 1B | Radiator Cap | S9970 | 1 | X | | | | | | | | |
| 1C | Drain Cock (Not Shown) | T9966 | 1 | X | | | | | | | | |
| 2A | Radiator Shell | L5163-2 | 1 | X | | | | | | | | |
| 2B | Thread Forming Screw | S9225-8 | 4 | X | | | | | | | | |
| 2C | Radiator Cap Cover | M8003 | 1 | X | | | | | | | | |
| 2D | Self Tapping Screw | S8025-12 | 2 | X | | | | | | | | |
| 4 | Fan Shroud Assembly | M19051 | 1 | X | | | | | | | | |
| 5A | Fan Guard | L16395 | 1 | X | | | | | | | | |
| 5B | Fan Guard (Alternator Side) | L16396 | 1 | X | | | | | | | | |

Fuel Tank & Mounting

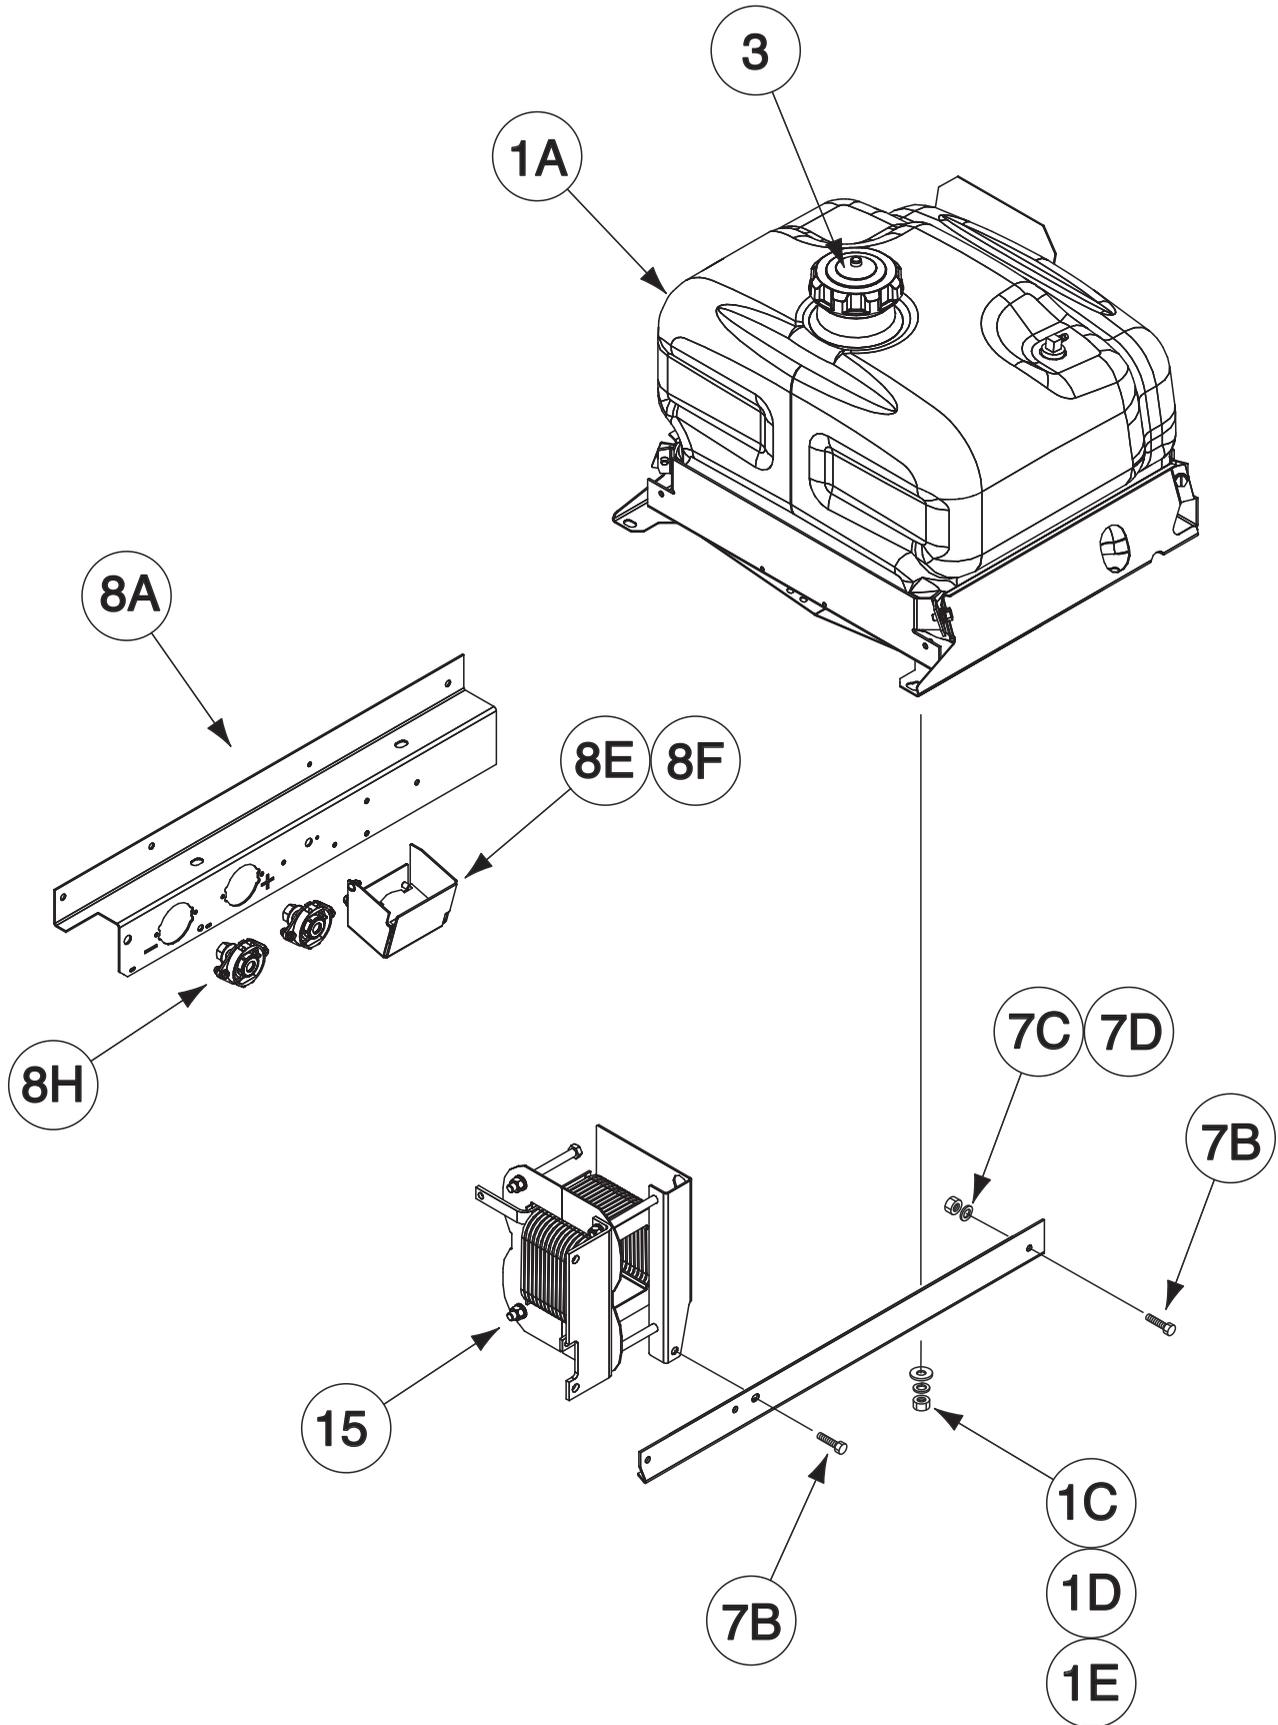


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|---|----------------------|--------|--------|---|---|---|---|---|---|---|---|
| 1A | Fuel Tank Asbly (Plastic Tank) | L15079 | 1 | X | | | | | | | | |
| 1B | 3/8-16 x 2.00 HHCS (Not Shown) | CF000071 | 4 | X | | | | | | | | |
| 1C | Plain Washer | S9262-56 | 8 | X | | | | | | | | |
| 1D | Lock Washer | E106A-4 | 4 | X | | | | | | | | |
| 1E | 3/8-16 HN | CF000067 | 4 | X | | | | | | | | |
| 2 | Gasket(Not Shown) | S10437-G | 1 | X | | | | | | | | |
| 3 | Fuel Cap | S20541 | 1 | X | | | | | | | | |
| 5A | Hose Connector (Not Shown) | T13595 | 1 | X | | | | | | | | |
| 5B | Gear Clamp (Not Shown) | S10888-35 | 2 | X | | | | | | | | |
| 7A | Fuel Tank Rail | M12479-1 | 1 | X | | | | | | | | |
| 7B | Thread Forming Screw | S9225-22 | 2 | X | | | | | | | | |
| 7C | Lock Washer | T9860-3 | 2 | X | | | | | | | | |
| 7D | 5/16-18 HN | CF000029 | 2 | X | | | | | | | | |
| 8A | Output Panel Asbly, Includes: Output Rail | M16685-4 M13946-1 | 1 1 | X X | | | | | | | | |
| 8B | Thread Forming Screw (Not Shown) | S9225-22 | 2 | X | | | | | | | | |
| 8C | Lock Washer (Not Shown) | T9860-3 | 2 | X | | | | | | | | |
| 8D | 5/16-18 HN (Not Shown) | CF000029 | 2 | X | | | | | | | | |
| 8E | Remote/Local Receptacle Asbly | M16779-2 | 1 | X | | | | | | | | |
| 8F | Remote/Local Receptacle Bracket | M25075 | 1 | X | | | | | | | | |
| 8G | Thread Forming Screw (Not Shown) | S9225-8 | 2 | X | | | | | | | | |
| 8H | Output Stud | M13900 | 2 | X | | | | | | | | |
| 8J | Self Tapping Screw (Not Shown) | S8025-91 | 4 | X | | | | | | | | |
| 8K | Self Tapping Screw (Not Shown) | S8025-75 | 1 | X | | | | | | | | |
| 8L | Output Rail Guard (Not Shown) | S24765 | 1 | X | | | | | | | | |
| 9 | Fuel Return Line (.1875 ID/.406 OD x 27.00) (Not Shown) | T10642-231 | 1 | X | | | | | | | | |
| 10 | Fuel Hose (Tank to Separator) (.312 ID/.562ODx10.5) (Not Shown) | T10642-86 | 1 | X | | | | | | | | |
| 15 | Choke Assembly | M24836 | 1 | X | | | | | | | | |

Base & Lift Bale Assembly

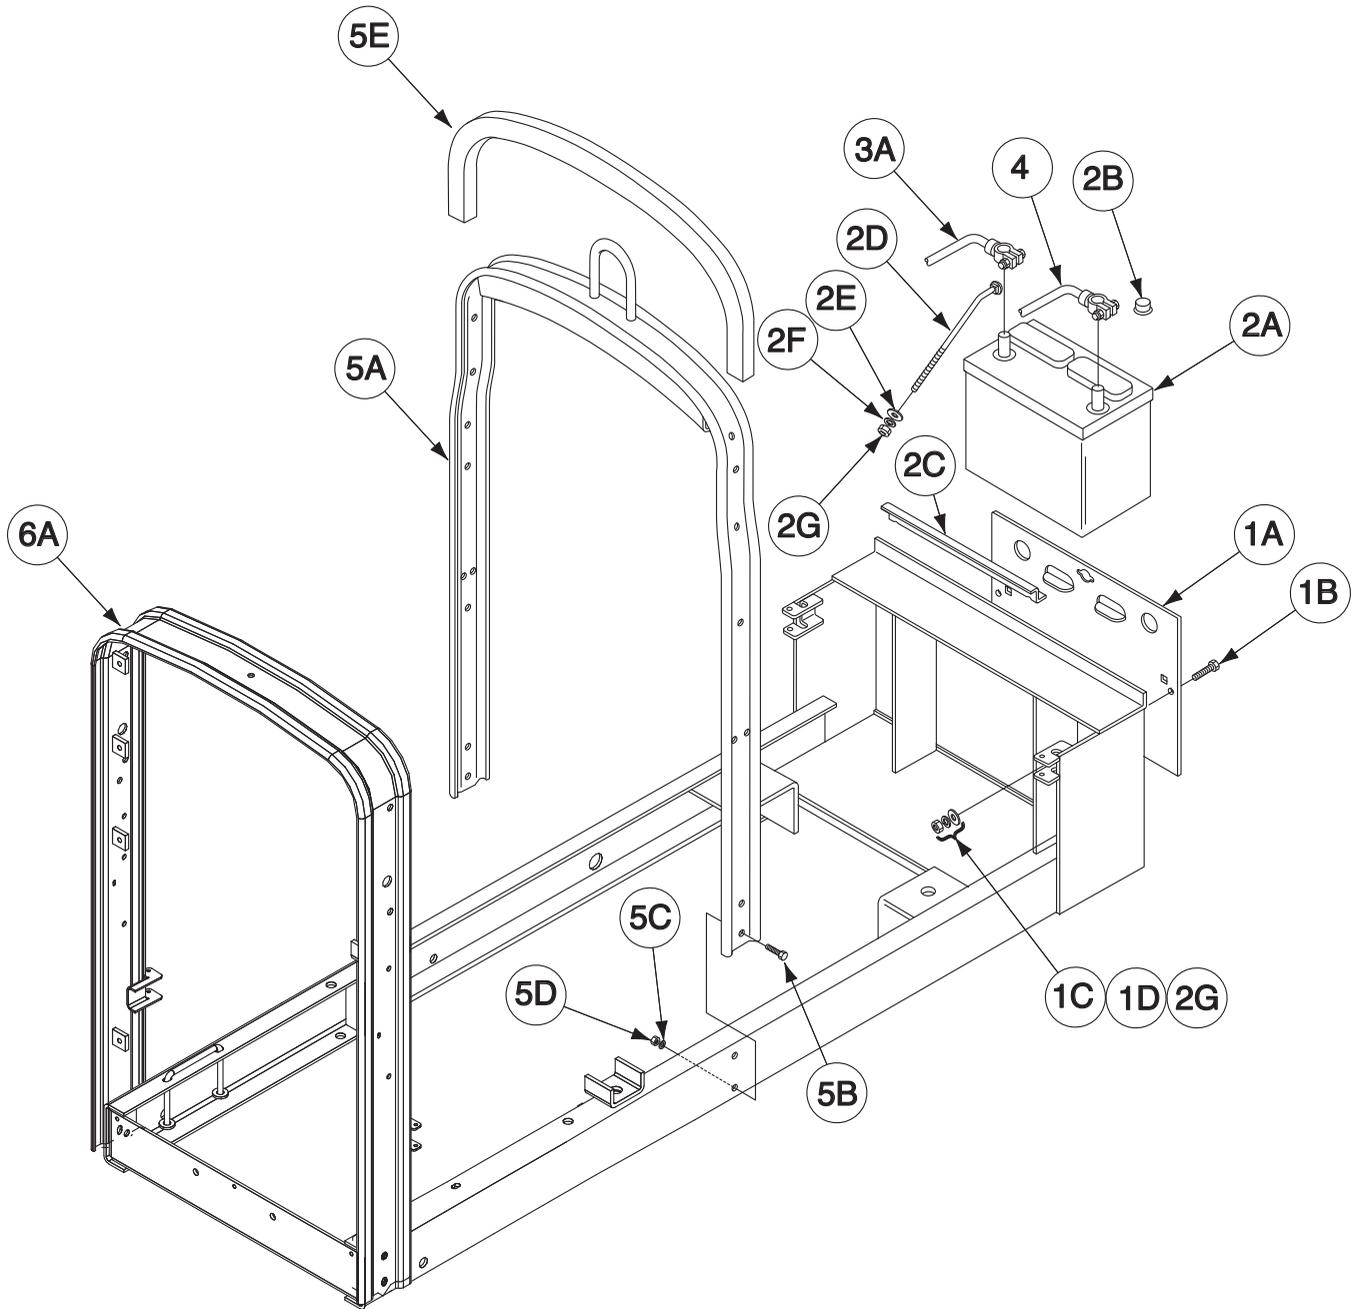


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|---|-----------|------|---|---|---|---|---|---|---|---|---|
| 1 | Base Assembly | G7568 | 1 | X | | | | | | | | |
| 1A | Battery Mounting Panel | S15639-1 | 1 | X | | | | | | | | |
| 1B | 1/4-20 x .50 HHCS | CF000012 | 2 | X | | | | | | | | |
| 1C | Lock Washer | E106A-2 | 2 | X | | | | | | | | |
| 1D | Plain Washer | S9262-23 | 2 | X | | | | | | | | |
| 2A | Battery (M9399-4) | N/A | 1 | X | | | | | | | | |
| 2B | Cap (Insulates Neg. Terminal) | T14654 | 1 | X | | | | | | | | |
| 2C | Battery Bracket | S12128 | 1 | X | | | | | | | | |
| 2D | Carriage Bolt | T11888 | 2 | X | | | | | | | | |
| 2E | Plain Washer | S9262-23 | 2 | X | | | | | | | | |
| 2F | Lock Washer | E106A-2 | 2 | X | | | | | | | | |
| 2G | 1/4-20 HN | CF000017 | 2 | X | | | | | | | | |
| 3A | Positive Battery Cable | S8070-29 | 1 | X | | | | | | | | |
| 3B | Lead Clip (Not Shown) | S24469 | 1 | X | | | | | | | | |
| 3C | Speed Nut (Not Shown) | T11525-5 | 1 | X | | | | | | | | |
| 3D | Thread Forming Screw (Not Shown) | S9225-8 | 1 | X | | | | | | | | |
| 4 | Negative Battery Cable & Ground Strap | S14922-1 | 1 | X | | | | | | | | |
| 4A | Thread Forming Screw (For Securing Cable & Strap) (Not Shown) | S9225-26 | 2 | X | | | | | | | | |
| 5A | Lift Bale & Hook Assembly | L9084 | 1 | X | | | | | | | | |
| 5B | 1/2-13 x 1.25 HHCS | T8833-24 | 4 | X | | | | | | | | |
| 5C | Lock Washer | E106A-5 | 4 | X | | | | | | | | |
| 5D | 1/2-13 HN | CF000027 | 4 | X | | | | | | | | |
| 5E | Foam | M15045-37 | 1 | X | | | | | | | | |
| 6A | Rear Support Assembly | M8237-15 | 1 | X | | | | | | | | |
| 6B | 3/8-16 x 1.00 HHCS (Not Shown) | CF000019 | 4 | X | | | | | | | | |
| 6C | Plain Washer (Not Shown) | S9262-120 | 4 | X | | | | | | | | |
| 6D | Lock Washer (Not Shown) | E106A-16 | 4 | X | | | | | | | | |
| 6E | 3/8-16 HN (Not Shown) | CF000067 | 4 | X | | | | | | | | |
| 6F | 5/16-18 HN (Not Shown) | CF000029 | 4 | X | | | | | | | | |

Welding Generator & Coupling (1 of 2)

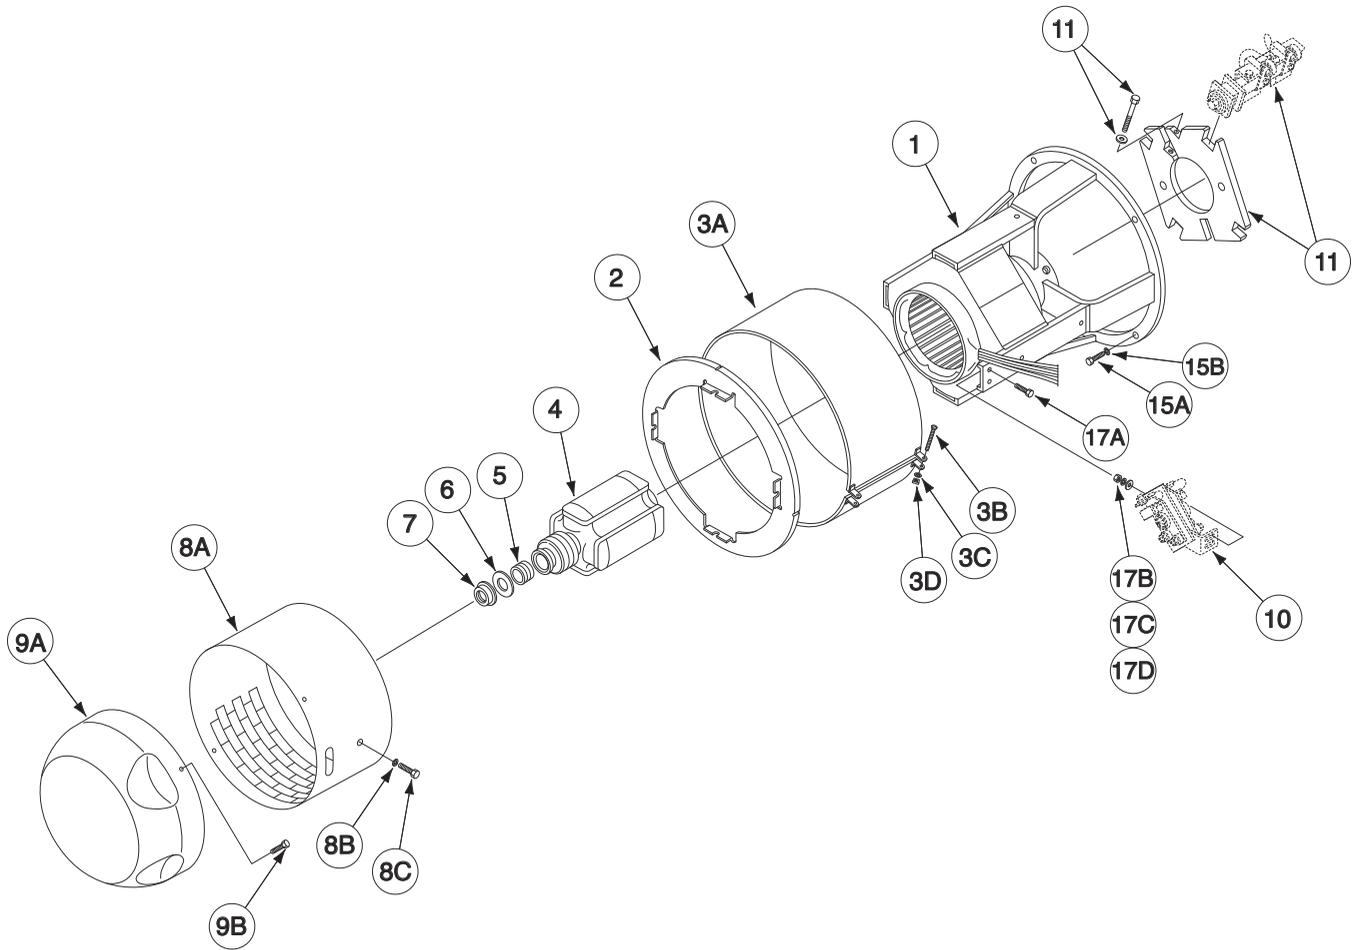


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|-----------------------------------|--------------|------|---|---|---|---|---|---|---|---|---|
| 1 | Exciter End Bracket | L6061-7 | 1 | X | | | | | | | | |
| 2 | Baffle | M13683 | 1 | X | | | | | | | | |
| 2A | Thread Forming Screw (Not Shown) | S9225-8 | 4 | X | | | | | | | | |
| 2B | Plain Washer (Not Shown) | S9262-23 | 4 | X | | | | | | | | |
| 2C | Lock Washer (Not Shown) | T9860-6 | 4 | X | | | | | | | | |
| 3A | Bracket Cover | L3391-46 | 1 | X | | | | | | | | |
| 3B | 1/4-20 x 2.00 RHS | CF000143 | 2 | X | | | | | | | | |
| 3C | Lock Washer | E106A-2 | 2 | X | | | | | | | | |
| 3D | Square Nut | CF000232 | 2 | X | | | | | | | | |
| 4 | Rotor Assembly Alternator | M13641-4 | 1 | X | | | | | | | | |
| 5 | Armature Sleeve Collar | T14337 | 1 | X | | | | | | | | |
| 6 | Exciter Nut Washer | T7090-1 | 1 | X | | | | | | | | |
| 7 | Exciter Nut | T6225-1 | 1 | X | | | | | | | | |
| 8A | Exciter Shroud | L8254 | 1 | X | | | | | | | | |
| 8B | Lock Washer | T9860-6 | 3 | X | | | | | | | | |
| 8C | Thread Forming Screw | S9225-8 | 3 | X | | | | | | | | |
| 9A | Blower Shroud | L6129-1 | 1 | X | | | | | | | | |
| 9B | Self Tapping Screw | S8025-91 | 4 | X | | | | | | | | |
| 10 | Alternator Brush Holder & Bracket | See P-737-M1 | 1 | X | | | | | | | | |
| 11 | Rocker & Brush Holder Assembly | See P-737-N1 | 1 | X | | | | | | | | |
| 14 | Generator Brush (Not Shown) | T2687 | 8 | X | | | | | | | | |
| 15A | 7/16-14 x 1.50 HHCS | T8833-2 | 4 | X | | | | | | | | |
| 15B | Lock Washer | E106A-8 | 4 | X | | | | | | | | |
| 17A | 1/4-20 x .75 HHCS | CF000014 | 2 | X | | | | | | | | |
| 17B | Plain Washer | S9262-23 | 2 | X | | | | | | | | |
| 17C | Lock Washer | E106A-2 | 2 | X | | | | | | | | |
| 17D | 1/4-20 HN | CF000017 | 2 | X | | | | | | | | |

Welding Generator & Coupling (2 of 2)

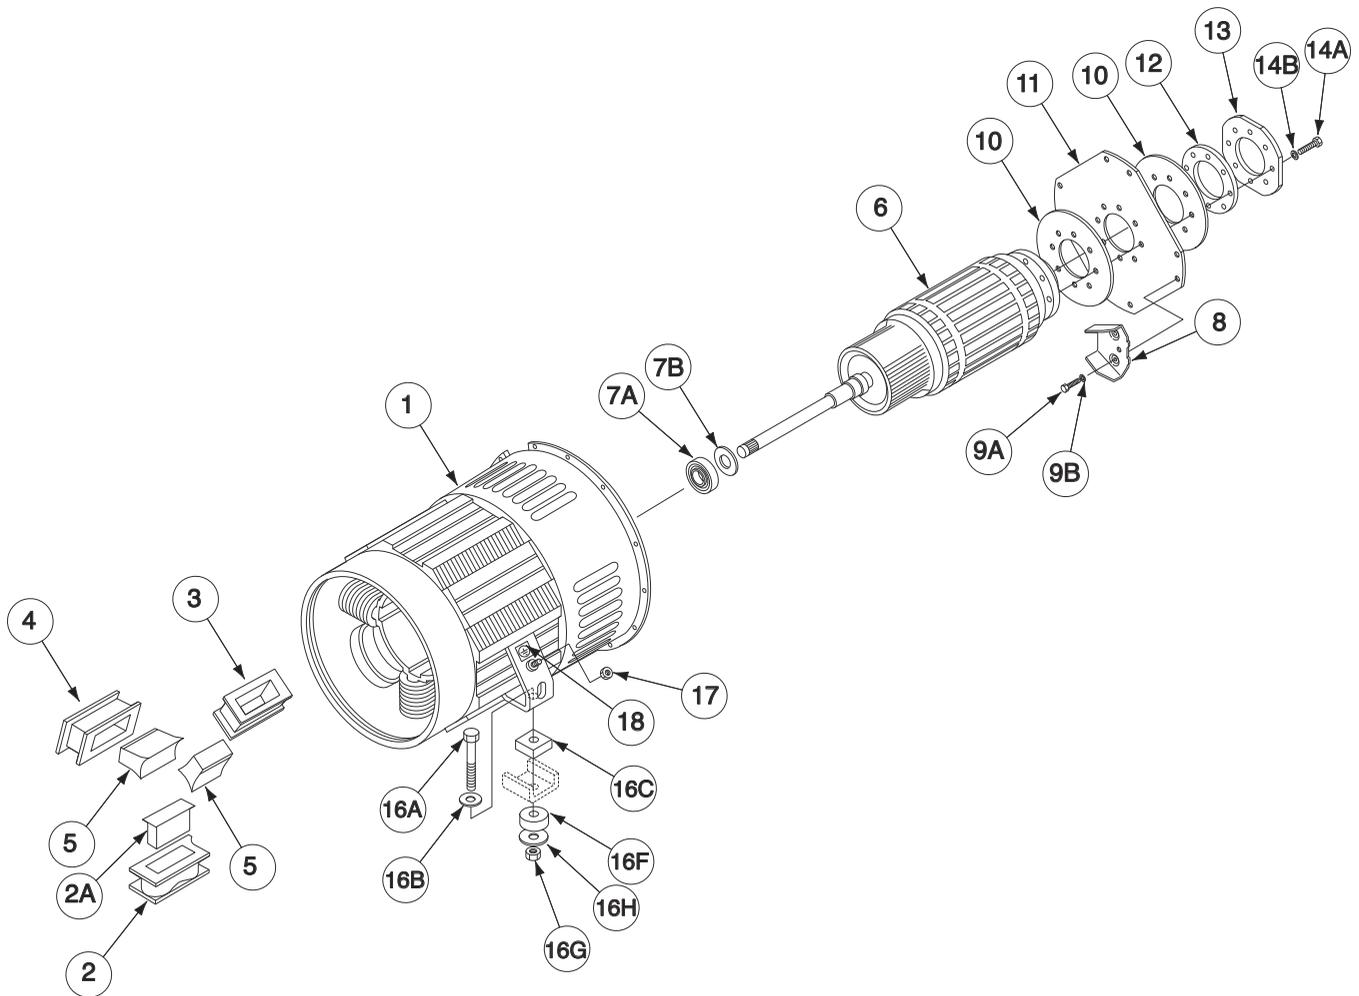


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|---|---------------------|--------|--------|---|---|---|---|---|---|---|---|
| 1 | Generator Frame Assembly, Includes: Frame Assembly | L8576-13 L9137-4 | 1 1 | X X | | | | | | | | |
| 2 | Interpole Coil & Pole Includes: | S12261-26 | 4 | X | | | | | | | | |
| 2A | Interpole Coil | S12261-26A | 4 | X | | | | | | | | |
| 2A | Interpole Lamination | S12260-8 | 4 | X | | | | | | | | |
| 3 | Shunt Coil (Top) | L1741-82 | 1 | X | | | | | | | | |
| 3 | Shunt Coil (Bottom) | L1741-83 | 1 | X | | | | | | | | |
| 4 | Series Coil (Top) | L16319-1 | 1 | X | | | | | | | | |
| 4 | Series Coil (Bottom) | L16319-2 | 1 | X | | | | | | | | |
| 5 | Main Poles | S10745-14 | 4 | X | | | | | | | | |
| 6 | Armature | M7014-14 | 1 | X | | | | | | | | |
| 7A | Bearing | M9300-180 | 1 | X | | | | | | | | |
| 7B | Bearing Shoulder Ring | S18541 | 1 | X | | | | | | | | |
| 8 | Blower Segments (Sold in Set of 4 Only) | M14361 | 1 | X | | | | | | | | |
| 9A | 7/16-14 x .75 HHCS (Blower Segments to Engine Coupling) | T8833-44 | 8 | X | | | | | | | | |
| 9B | Lock Washer | E106A-8 | 8 | X | | | | | | | | |
| 10 | Disc Backing Plate | S8042 | 2 | X | | | | | | | | |
| 11 | Coupling Disc | M6730 | 1 | X | | | | | | | | |
| 12 | Coupling Ring (Inside) | S14233 | 1 | X | | | | | | | | |
| 13 | Coupling Ring (Outside-Closest to Engine) | S14232 | 1 | X | | | | | | | | |
| 14A | 7/16-14 x 1.50 HHCS (Coupling Rings to Armature Hub) | T8833-2 | 8 | X | | | | | | | | |
| 14B | Lock Washer | E106A-8 | 8 | X | | | | | | | | |
| 15A | 3/8-16 x 1.00 HHCS (Not Shown) | CF000019 | 5 | X | | | | | | | | |
| 15B | Lock Washer (Not Shown) | E106A-16 | 5 | X | | | | | | | | |
| 16A | 1/2-13 x 2.75 HHCS | CF000123 | 2 | X | | | | | | | | |
| 16B | Plain Washer | S9262-1 | 2 | X | | | | | | | | |
| 16C | Welder Foot Support Rubber | T8823 | 2 | X | | | | | | | | |
| 16E | Mounting Bracket (Not Shown) | S10040-86 | 2 | X | | | | | | | | |
| 16F | Rubber Pad | T8822 | 2 | X | | | | | | | | |
| 16G | 1/2-13 HLN | T9187-4 | 2 | X | | | | | | | | |
| 16H | Plain Washer | S9262-5 | 2 | X | | | | | | | | |
| 17 | 3/8-16 HN | CF000067 | 2 | X | | | | | | | | |
| 18 | Ground Decal | T13260-4 | 2 | X | | | | | | | | |

Roof & Doors

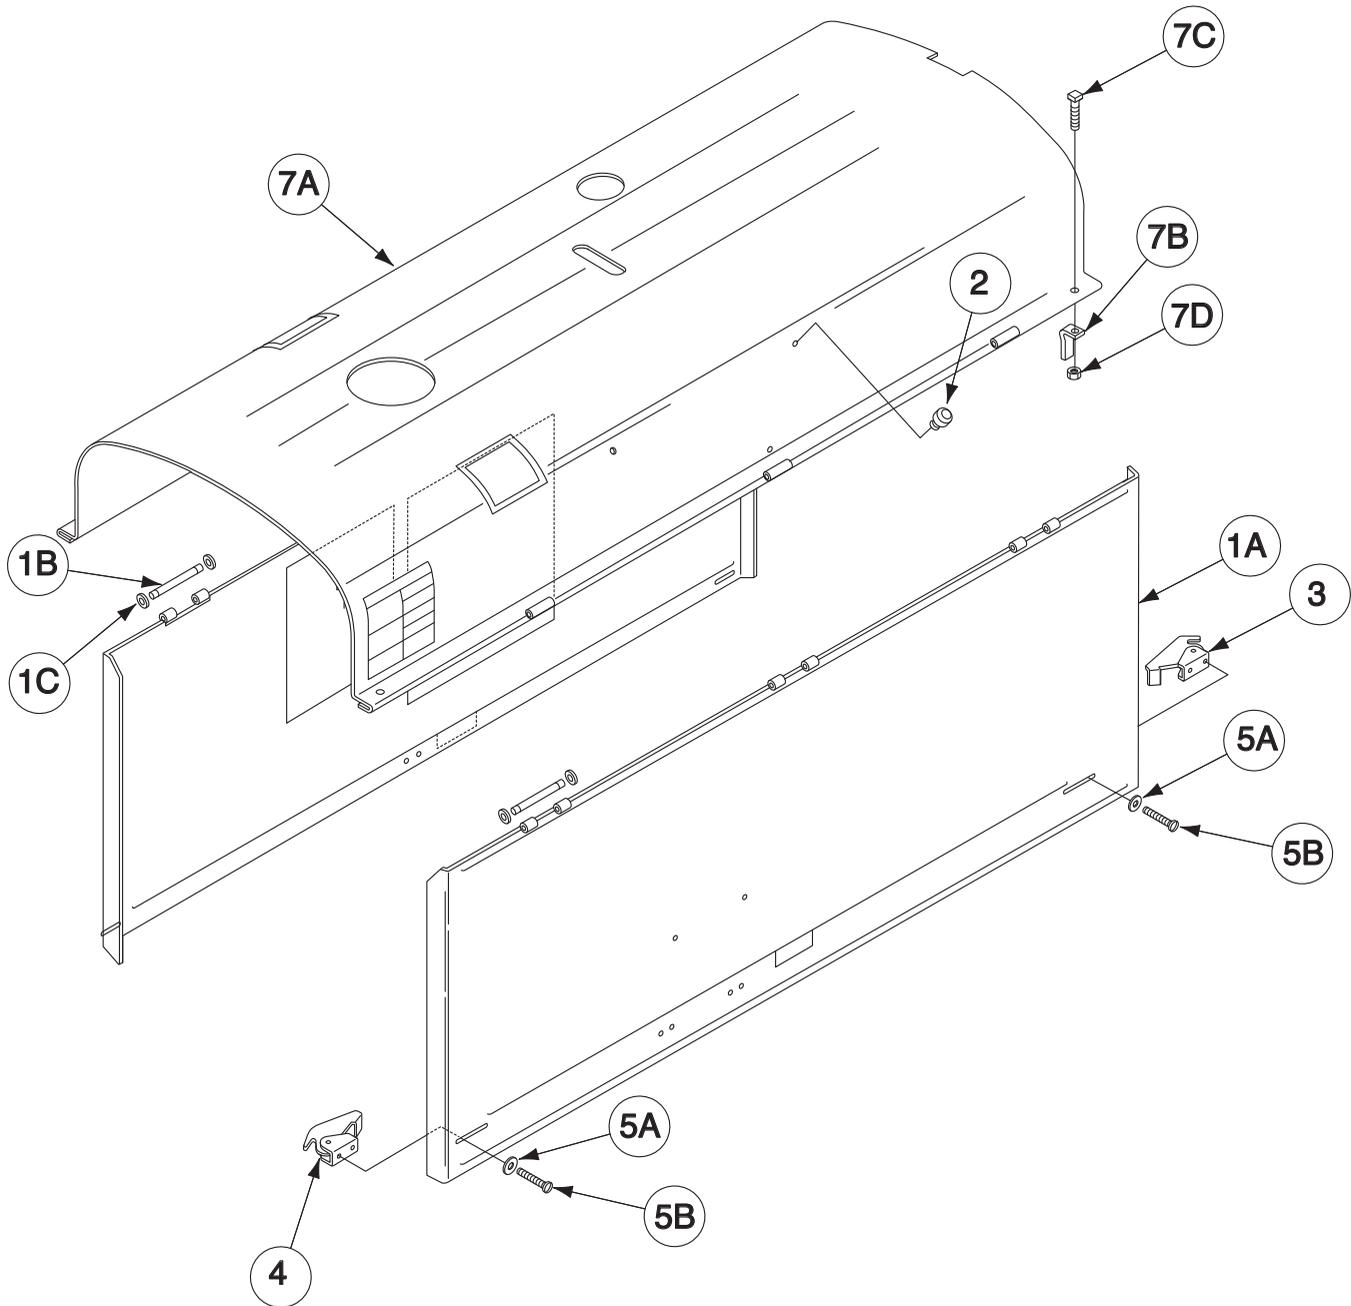


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|--------------------------------|------------|------|---|---|---|---|---|---|---|---|---|
| 1A | Door | L6659-8 | 2 | X | | | | | | | | |
| 1B | Door Hinge Pin | S20295 | 6 | X | | | | | | | | |
| 1C | Retaining Ring | S9776-62 | 12 | X | | | | | | | | |
| 2 | Door Bumper (Mounts in Roof) | T15154 | 4 | X | | | | | | | | |
| 3 | Door Hook Assembly | S10656-3 | 2 | X | | | | | | | | |
| 4 | Door Hook Assembly | S10656-4 | 2 | X | | | | | | | | |
| 5A | Door Hook Washer | T10878 | 4 | X | | | | | | | | |
| 5B | Self Tapping Screw | S8025-92 | 8 | X | | | | | | | | |
| 7A | Roof | L5193-7 | 1 | X | | | | | | | | |
| 7B | Roof Mounting Angle | S13593 | 4 | X | | | | | | | | |
| 7C | 5/16-18 x 1.50 SQHS | CF000258 | 4 | X | | | | | | | | |
| 7D | 5/16-18 HLN | T9187 | 4 | X | | | | | | | | |
| 9 | Warning Decal (Not Shown) | S25896-1 | 1 | X | | | | | | | | |
| 10 | CO Warning Decal (Not Shown) | M21436 | 1 | X | | | | | | | | |
| 11 | Fuel Warning Decal (Not Shown) | T13086-205 | 1 | X | | | | | | | | |
| 12 | Door Slide (Not Shown) | S30157 | 2 | X | | | | | | | | |
| 13 | Wiring Diagram (Not Shown) | M24777 | 1 | X | | | | | | | | |

Alternator Brush Holder

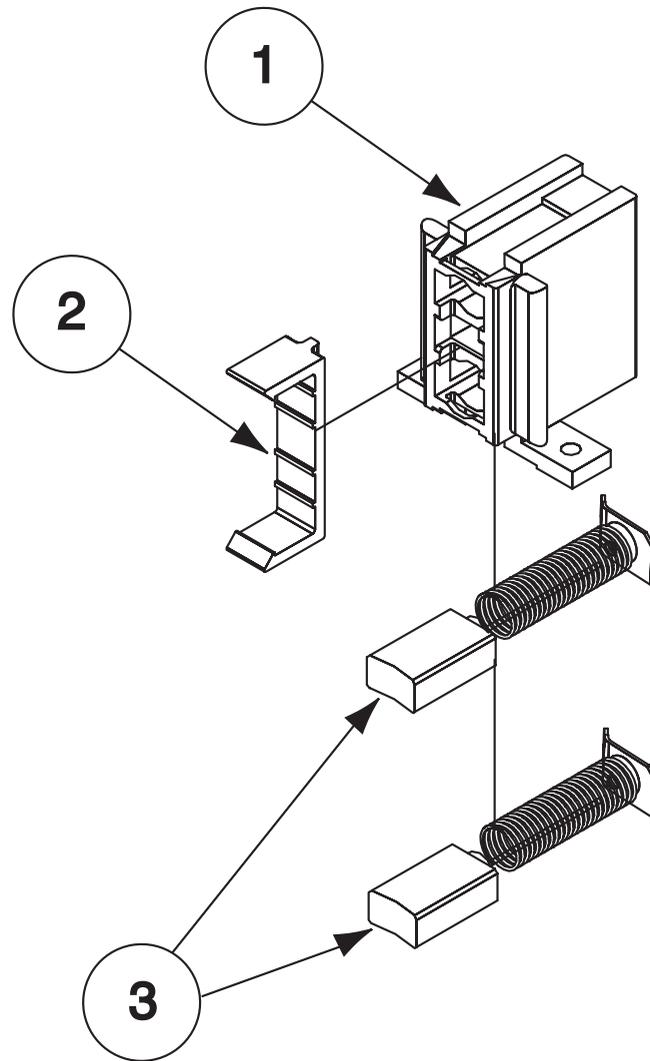


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|---|-----------------|--------|--------|---|---|---|---|---|---|---|---|
| 1 | Alternator Brush Holder Assembly, Includes: Brush Holder Cartridge | M16158 G2114 | 1 1 | X X | | | | | | | | |
| 2 | Brush Assembly Retainer | M16157 | 1 | X | | | | | | | | |
| 3 | Brush Assembly | S19480 | 2 | X | | | | | | | | |
| 4 | Brush Holder Bracket (Not Shown) | M19896 | 1 | X | | | | | | | | |

Generator Brush Holder

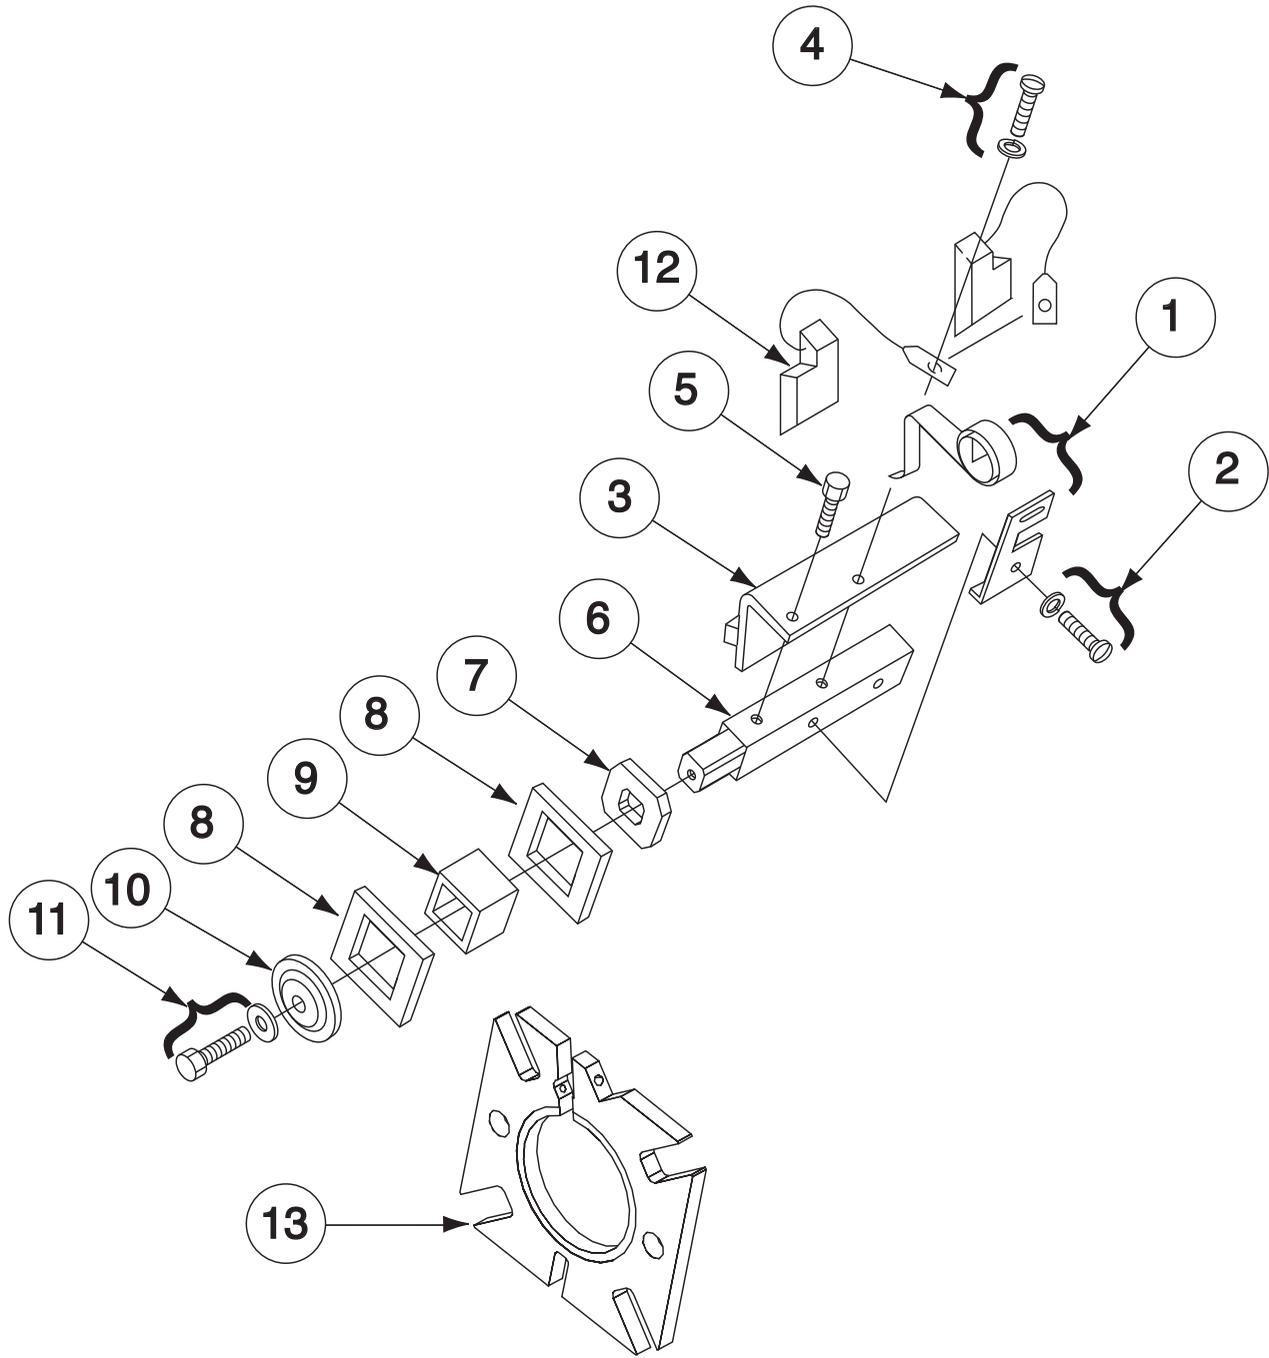


Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|--------------------------------|-----------|------|---|---|---|---|---|---|---|---|---|
| 1 | Rocker & Brush Holder Assembly | S13247-54 | 1 | X | | | | | | | | |
| 2 | Spring & Clip Assembly | T8495 | 2 | X | | | | | | | | |
| 2 | 5/16-18 x .75 HHCS | CF000040 | 2 | X | | | | | | | | |
| 3 | Plate and Retainer Assembly | M6304-2B | 1 | X | | | | | | | | |
| 4 | 5/16-18 x .75 HHCS | CF000040 | 1 | X | | | | | | | | |
| 5 | 5/16-18 x .625 HHCS | CF000106 | 1 | X | | | | | | | | |
| 6 | Stud | M6963-4 | 1 | X | | | | | | | | |
| 7 | Clamping Washer | T9020 | 1 | X | | | | | | | | |
| 8 | Insulating Washer | T4479 | 2 | X | | | | | | | | |
| 9 | Insulating Tube | S13721-1 | 1 | X | | | | | | | | |
| 10 | Clamping Washer | T2414 | 1 | X | | | | | | | | |
| 11 | 3/8-16 x 1.00 HHCS | CF000019 | 1 | X | | | | | | | | |
| 11 | Lock Washer | E106A-16 | 1 | X | | | | | | | | |
| 12 | Generator Brush | T2687 | 8 | X | | | | | | | | |
| 13 | Rocker Assembly, Includes: | S16986-1 | 1 | X | | | | | | | | |
| | Rocker | M9857-1 | 1 | X | | | | | | | | |
| | Lock Washer (Not Shown) | E106A-2 | 1 | X | | | | | | | | |
| | 1/4-20 x 2.00 HHCS (Not Shown) | T8833-22 | 1 | X | | | | | | | | |

Roll Cage Assembly

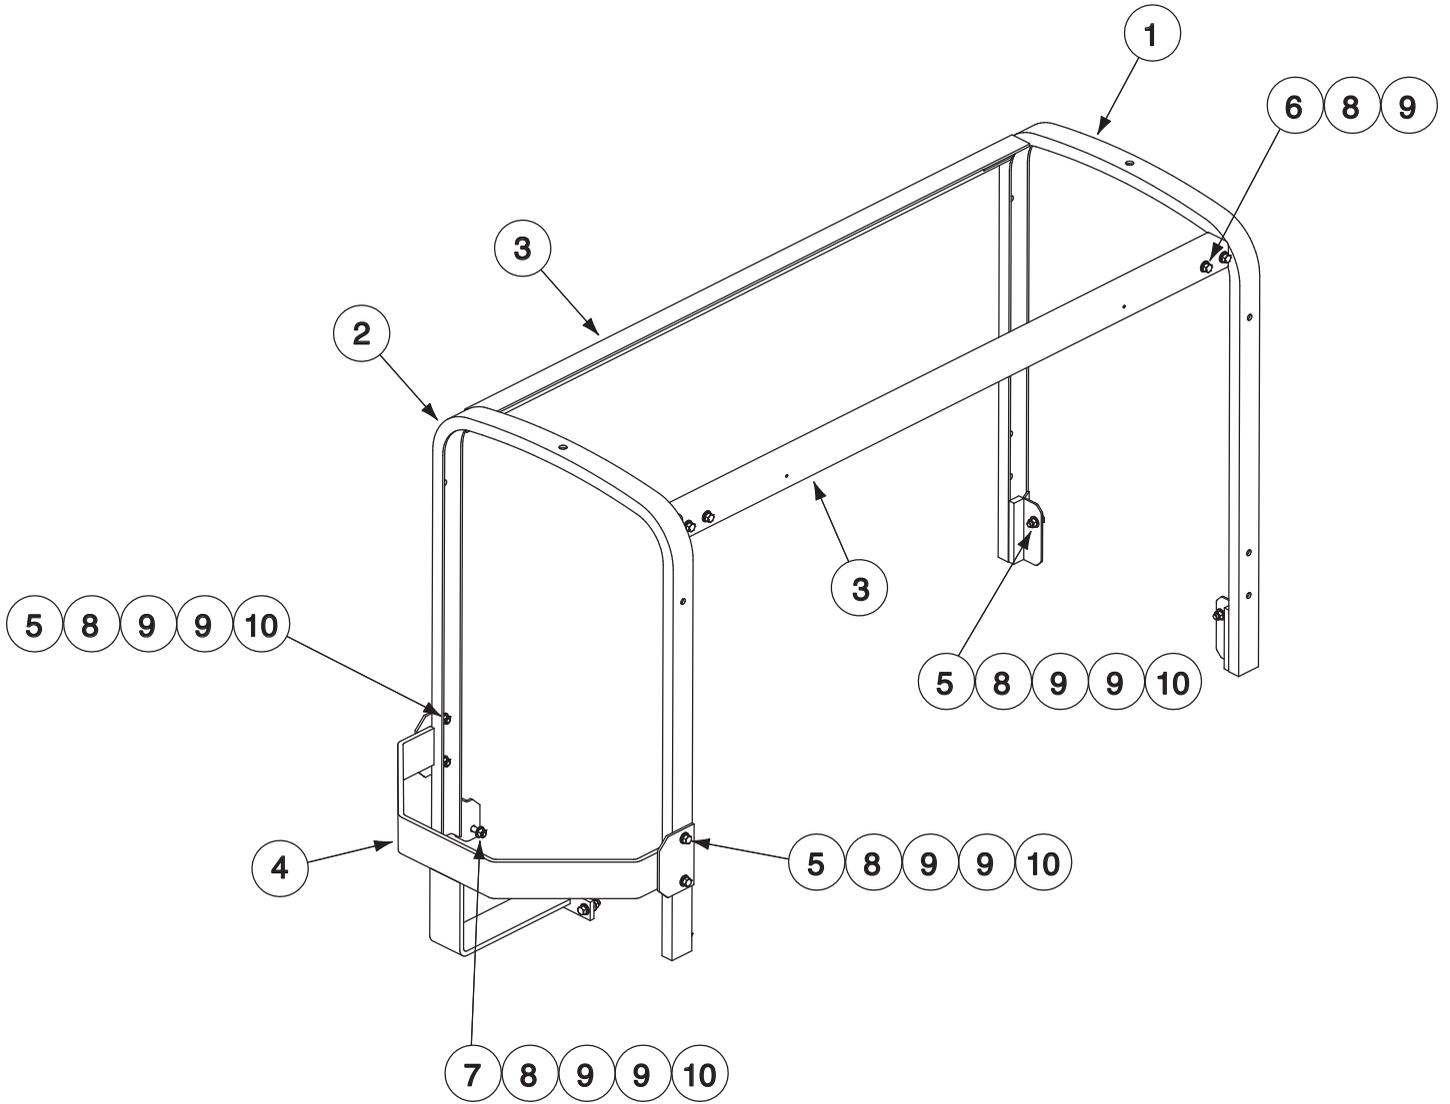

Indicates a change this printing.

Use only the parts marked "x" in the column under the heading number called for in the model index page.

| ITEM | DESCRIPTION | PART NO. | QTY. | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 |
|------|-------------------------------|-----------|------|---|---|---|---|---|---|---|---|---|
| 1 | Roll Cage Assembly, Includes: | L16582 | 1 | X | | | | | | | | |
| 1A | Rear Support Assembly | M25108 | 1 | X | | | | | | | | |
| 2 | Front Support Assembly | M25085 | 1 | X | | | | | | | | |
| 3 | Side Rail | M25109 | 2 | X | | | | | | | | |
| 4 | Bullnose Assembly | M25086 | 1 | X | | | | | | | | |
| 5 | 3/8-16 x .50 HHCS | CF000019 | 6 | X | | | | | | | | |
| 6 | 3/8-16 x .75 HHCS | CF000034 | 8 | X | | | | | | | | |
| 7 | 3/8-16 x 1.50 HHCS | CF000066 | 4 | X | | | | | | | | |
| 8 | Lock Washer | E106A-16 | 18 | X | | | | | | | | |
| 9 | Plain Washer | S9262-120 | 28 | X | | | | | | | | |
| 10 | 3/8-16 HN | CF000067 | 10 | X | | | | | | | | |

NOTES

D300K 3+3 SE KUBOTA

Red-D-Arc
Weiderentals.

NOTES

| | | | |
|---|--|---|---|
|  |  |  |  |
| <ul style="list-style-type: none"> ● Keep your head out of fumes. ● Use ventilation or exhaust to remove fumes from breathing zone. | <ul style="list-style-type: none"> ● Turn power off before servicing. | <ul style="list-style-type: none"> ● Do not operate with panel open or guards off. | WARNING |
| <ul style="list-style-type: none"> ● Los humos fuera de la zona de respiración. ● Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases. | <ul style="list-style-type: none"> ● Desconectar el cable de alimentación de poder de la máquina antes de iniciar cualquier servicio. | <ul style="list-style-type: none"> ● No operar con panel abierto o guardas quitadas. | Spanish AVISO DE PRECAUCION |
| <ul style="list-style-type: none"> ● Gardez la tête à l'écart des fumées. ● Utilisez un ventilateur ou un aspirateur pour ôter les fumées des zones de travail. | <ul style="list-style-type: none"> ● Débranchez le courant avant l'entretien. | <ul style="list-style-type: none"> ● N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés. | French ATTENTION |
| <ul style="list-style-type: none"> ● Vermeiden Sie das Einatmen von Schweißrauch! ● Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes! | <ul style="list-style-type: none"> ● Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öffnen; Maschine anhalten!) | <ul style="list-style-type: none"> ● Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen! | German WARNUNG |
| <ul style="list-style-type: none"> ● Mantenha seu rosto da fumaça. ● Use ventilação e exaustão para remover fumo da zona respiratória. | <ul style="list-style-type: none"> ● Não opere com as tampas removidas. ● Desligue a corrente antes de fazer serviço. ● Não toque as partes elétricas nuas. | <ul style="list-style-type: none"> ● Mantenha-se afastado das partes moventes. ● Não opere com os painéis abertos ou guardas removidas. | Portuguese ATENÇÃO |
| <ul style="list-style-type: none"> ● ヒュームから頭を離すようにして下さい。 ● 換気や排煙に十分留意して下さい。 | <ul style="list-style-type: none"> ● メンテナンス・サービスに取りかかる際には、まず電源スイッチを必ず切ってください。 | <ul style="list-style-type: none"> ● パネルやカバーを取り外したままで機械操作をしないで下さい。 | Japanese 注意事項 |
| <ul style="list-style-type: none"> ● 頭部遠離煙霧。 ● 在呼吸區使用通風或排風器除煙。 | <ul style="list-style-type: none"> ● 維修前切斷電源。 | <ul style="list-style-type: none"> ● 儀表板打開或沒有安全罩時不準作業。 | Chinese 警告 |
| <ul style="list-style-type: none"> ● 얼굴로부터 용접가스를 멀리하십시오. ● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시오. | <ul style="list-style-type: none"> ● 보수전에 전원을 차단하십시오. | <ul style="list-style-type: none"> ● 관널이 열린 상태로 작동치 마십시오. | Korean 위험 |
| <ul style="list-style-type: none"> ● ابعد رأسك بعيداً عن الدخان. ● استعمل التهوية أو جهاز ضغط الدخان للخارج لكي تبعد الدخان عن المنطقة التي تتنفس فيها. | <ul style="list-style-type: none"> ● أقطع التيار الكهربائي قبل القيام بأية صيانة. | <ul style="list-style-type: none"> ● لا تشغيل هذا الجهاز اذا كانت الاغطية الحديدية الواقية ليست عليه. | Arabic تحذير |

LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的說明以及應該使用的銀焊材料，並請遵守貴方的有關勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.

| | | | |
|---|---|---|---|
|  |  |  |  |
| WARNING | <ul style="list-style-type: none"> ● Do not touch electrically live parts or electrode with skin or wet clothing. ● Insulate yourself from work and ground. | <ul style="list-style-type: none"> ● Keep flammable materials away. | <ul style="list-style-type: none"> ● Wear eye, ear and body protection. |
| Spanish AVISO DE PRECAUCION | <ul style="list-style-type: none"> ● No toque las partes o los electrodos bajo carga con la piel o ropa mojada. ● Aislese del trabajo y de la tierra. | <ul style="list-style-type: none"> ● Mantenga el material combustible fuera del área de trabajo. | <ul style="list-style-type: none"> ● Protéjase los ojos, los oídos y el cuerpo. |
| French ATTENTION | <ul style="list-style-type: none"> ● Ne laissez ni la peau ni des vêtements mouillés entrer en contact avec des pièces sous tension. ● Isolez-vous du travail et de la terre. | <ul style="list-style-type: none"> ● Gardez à l'écart de tout matériel inflammable. | <ul style="list-style-type: none"> ● Protégez vos yeux, vos oreilles et votre corps. |
| German WARNUNG | <ul style="list-style-type: none"> ● Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung! ● Isolieren Sie sich von den Elektroden und dem Erdboden! | <ul style="list-style-type: none"> ● Entfernen Sie brennbares Material! | <ul style="list-style-type: none"> ● Tragen Sie Augen-, Ohren- und Körperschutz! |
| Portuguese ATENÇÃO | <ul style="list-style-type: none"> ● Não toque partes elétricas e electrodos com a pele ou roupa molhada. ● Isole-se da peça e terra. | <ul style="list-style-type: none"> ● Mantenha inflamáveis bem guardados. | <ul style="list-style-type: none"> ● Use proteção para a vista, ouvido e corpo. |
| Japanese 注意事項 | <ul style="list-style-type: none"> ● 通電中の電気部品、又は溶材にヒフやぬれた布で触れないこと。 ● 施工物やアースから身体が絶縁されている様にして下さい。 | <ul style="list-style-type: none"> ● 燃えやすいものの側での溶接作業は絶対にしてはなりません。 | <ul style="list-style-type: none"> ● 目、耳及び身体に保護具をして下さい。 |
| Chinese 警告 | <ul style="list-style-type: none"> ● 皮肤或湿衣物切勿接触带电部件及焊條。 ● 使你自已與地面和工件絕緣。 | <ul style="list-style-type: none"> ● 把一切易燃物品移離工作場所。 | <ul style="list-style-type: none"> ● 佩戴眼、耳及身體勞動保護用具。 |
| Korean 위험 | <ul style="list-style-type: none"> ● 전도체나 용접봉을 젖은 형갑 또는 피부로 절대 접촉치 마십시오. ● 모재와 접지를 접촉치 마십시오. | <ul style="list-style-type: none"> ● 인화성 물질을 접근 시키지 마시오. | <ul style="list-style-type: none"> ● 눈, 귀와 몸에 보호장구를 착용하십시오. |
| Arabic تحذير | <ul style="list-style-type: none"> ● لا تلمس الاجزاء التي يسري فيها التيار الكهربائي أو الاكترود بجدن الجسم أو بالملابس المبللة بالماء. ● ضع عازلا على جسمك خلال العمل. | <ul style="list-style-type: none"> ● ضع المواد القابلة للاشتعال في مكان بعيد. | <ul style="list-style-type: none"> ● ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك. |

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.

SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.

LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.

LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.

Need Help?

Lincoln Electric “Rapid Response” Service!



Call **1.888.935.3877** to talk to a Service Representative

Hours of Operation: 8:00 AM to 6:00 PM (ET) Mon. thru Fri.

After hours? Use “Ask the Experts” at lincolnelectric.com

A Lincoln Service Representative will contact you no later than the following business day.

- For Service outside the USA: Email globalservice@lincolnelectric.com



Copyright © Lincoln Global Inc.

• World's Leader in Welding and Cutting Products • • Sales and Service through Subsidiaries and Distributors Worldwide •
Cleveland, Ohio 44117-1199 USA TEL: 1.216.481.8100 FAX: 1.216.486.1751 WEB SITE: lincolnelectric.com
For Service in the USA and Canada: Call 1.888.935.3877 For Service outside the USA: Email globalservice@lincolnelectric.com