


PARTS LIST FOR

ZR-8

ZR-8



ILLUSTRATION OF SUB ASSEMBLIES

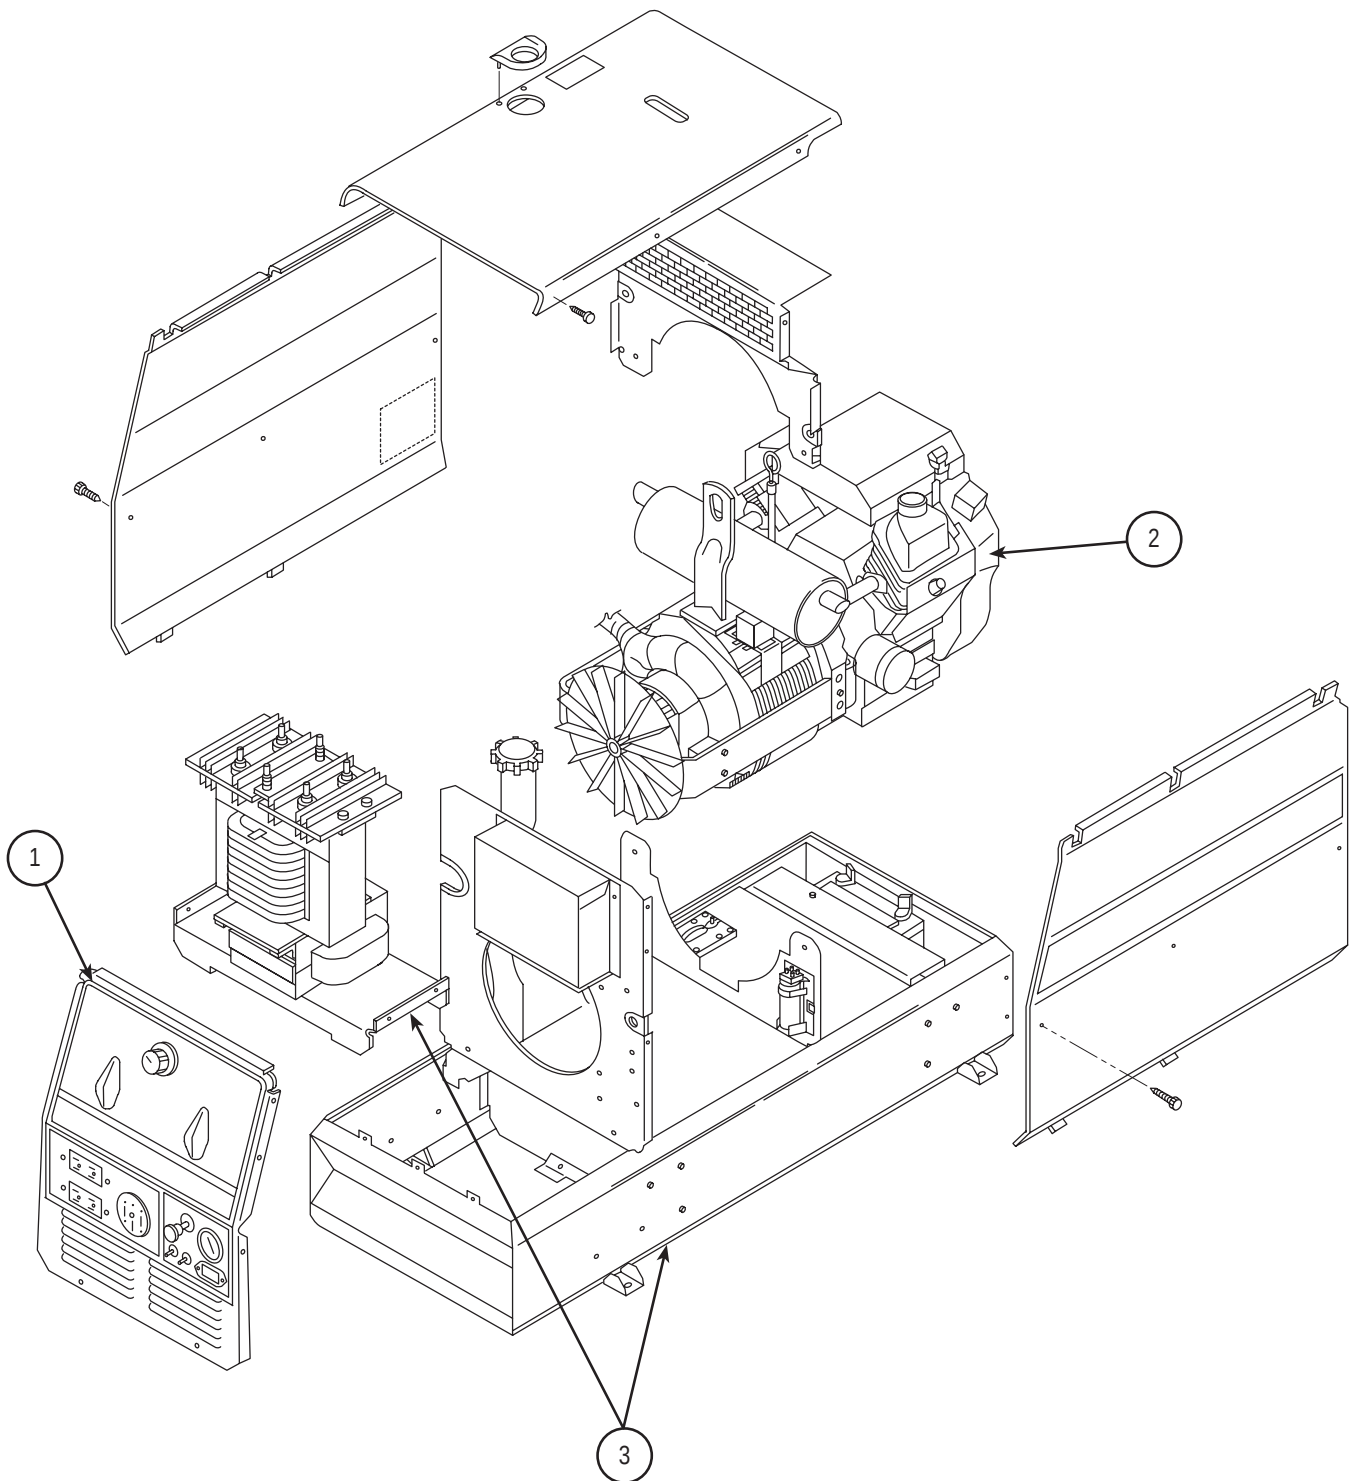

OPTIONAL EQUIPMENT LISTING

Miscellaneous Options Available for your machine are listed below:


Indicates a change this printing.

DESCRIPTION	PART NUMBER
Water Valve Kit (For K799)	Order K844
Auxiliary Power Plug Kit	Order K802R
Canvas Cover	Order K886-1
Spark Arrestor	Order K894-1
GFCI Receptacle Kit	Order K896-1
Remote Output Control	Order K857
Accessory Package	Order K710
Remote Control Receptacle Kit	Order K892-1
Rotor Pulling Kit	Order S20788
(Available to Field Service Shops Only)	
High Frequency Kit	Order K799
High Frequency Mounting Kit	Order K902-3
Adapter	Order K915-1
GFCI Receptical Kit (Above Code 10500)	Order K896-1

Indicates a change this printing.

* Recommended Spare Part

[illegible]

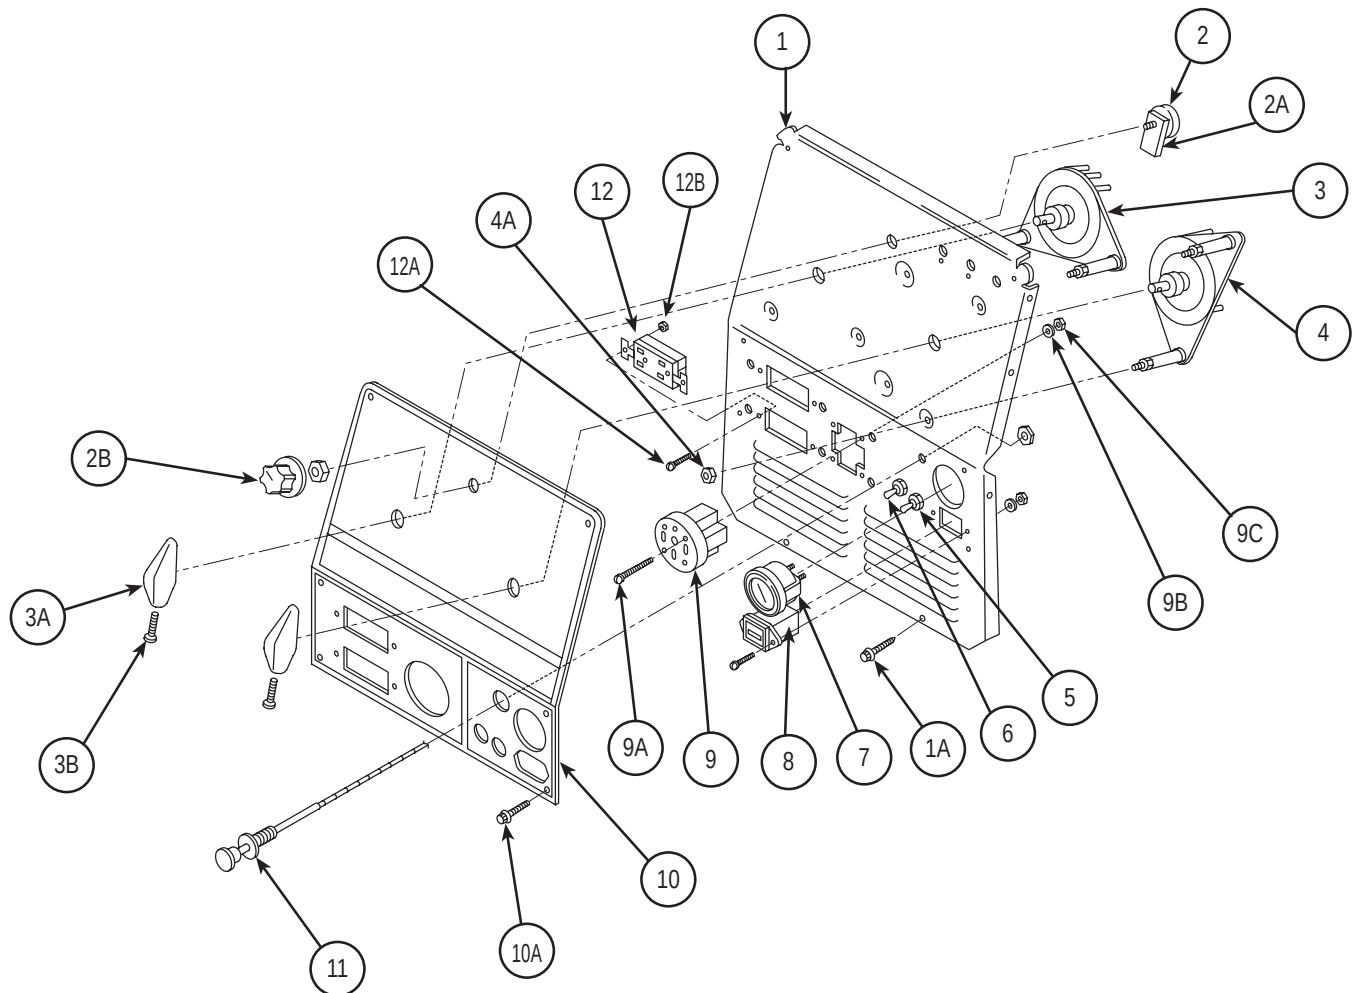CASE FRONT ASSEMBLY


Indicates a change this printing.

* Recommended Spare Part

Use only the parts marked “x” in the column under the heading number called for in the model index page.

[illegible]

ENGINE/ROTOR/STATOR ASSEMBLY

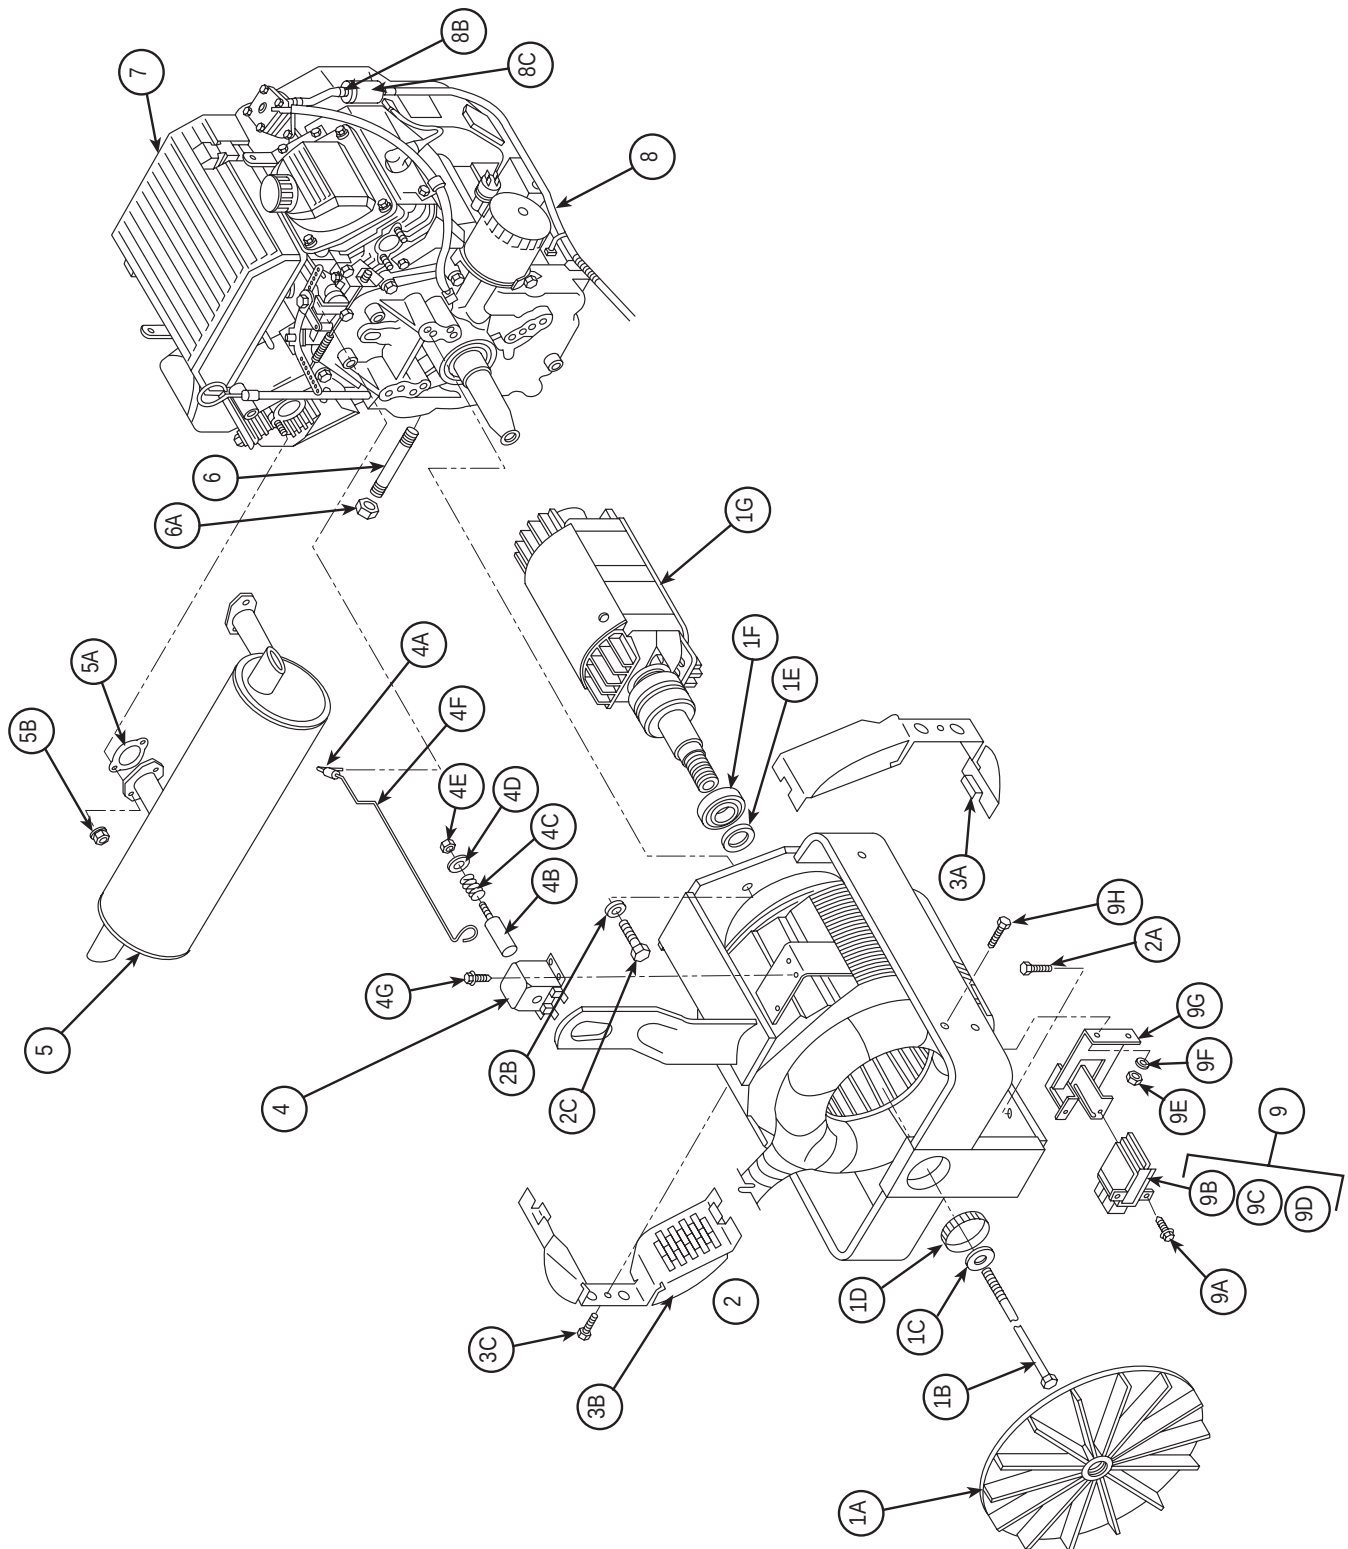


Indicates a change this printing.

* Recommended Spare Part

Use only the parts marked “x” in the column under the heading number called for in the model index page.

[illegible]

BASE ASSEMBLY (1 OF 2)

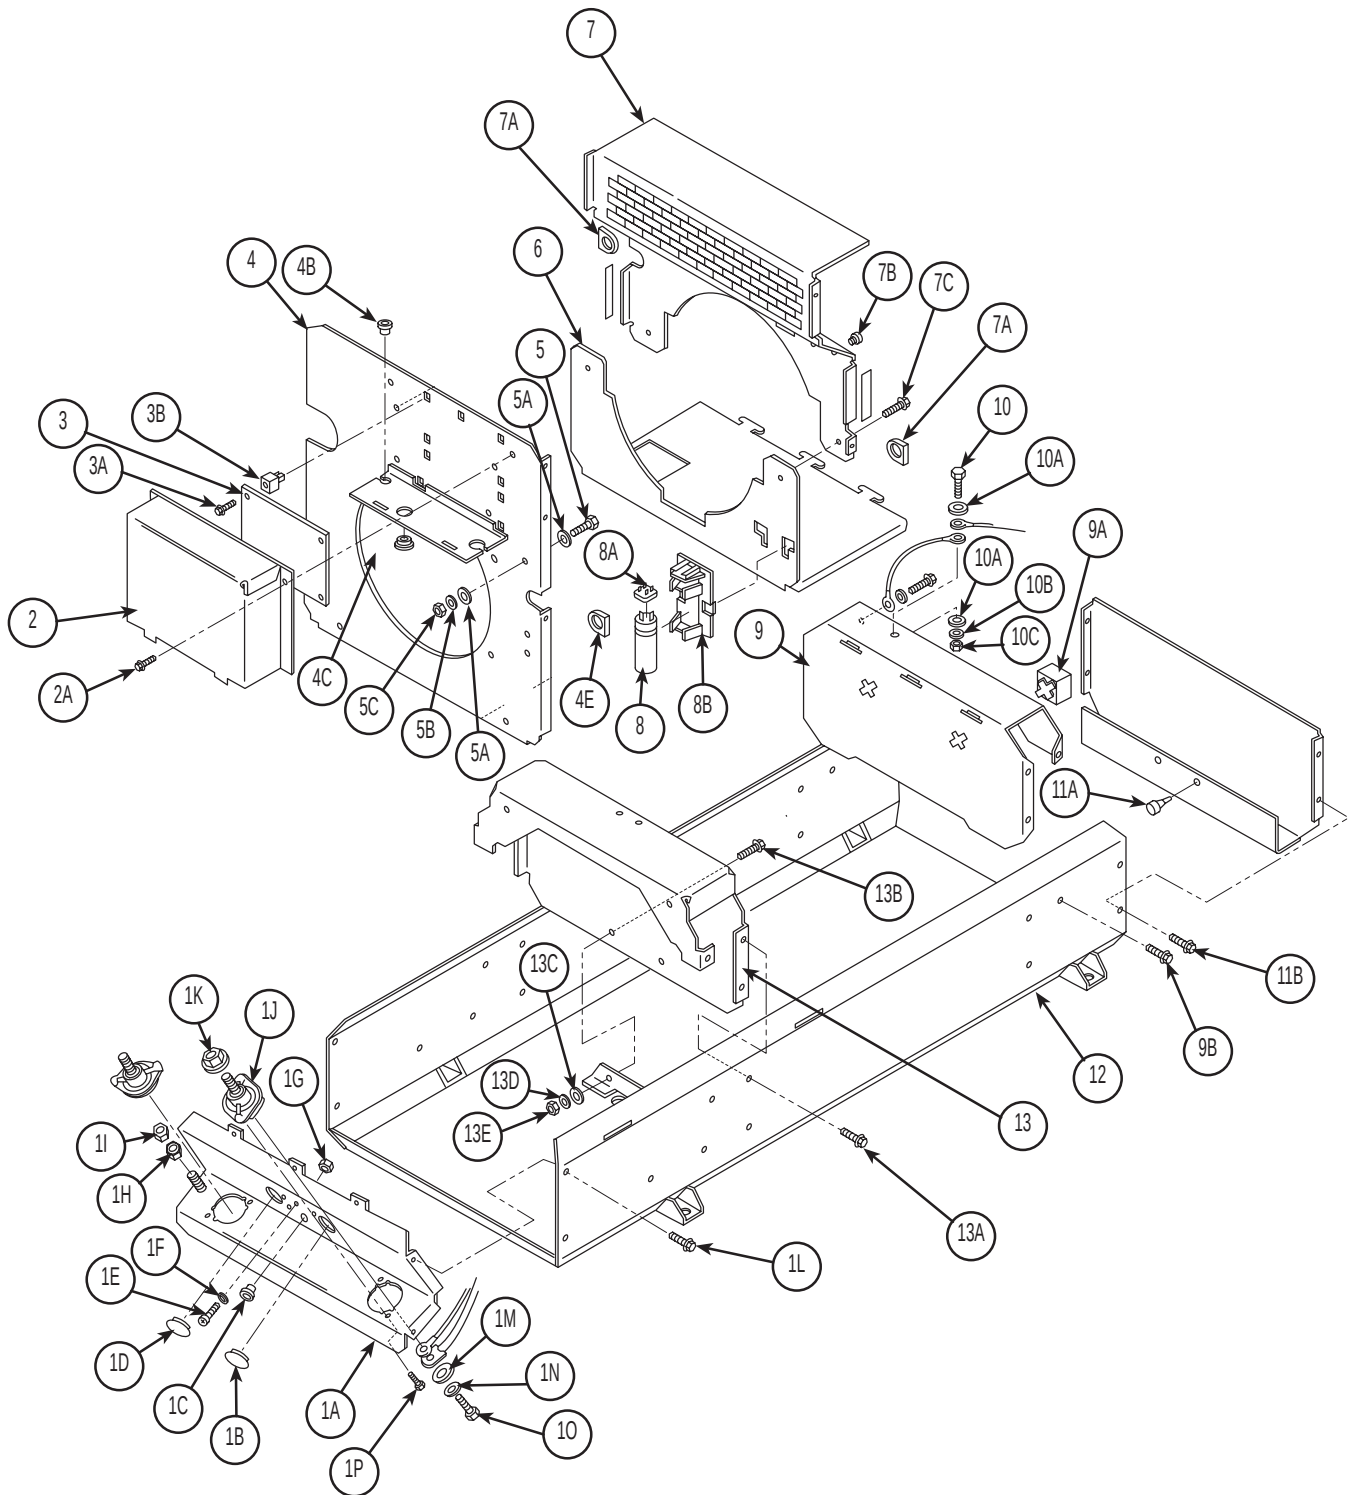

Indicates a change this printing.

* Recommended Spare Part

Use only the parts marked "x" in the column under the heading number called for in the model index page.

ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
1	Lower Case Front Assembly, Includes: (Includes 1A-1L)	M17231-1	1	X								
1A	Lower Case Front Welded Assembly	M17009	1	X								
1B	Plug Button	T10397-10	1	X								
1C	Plug Button	T10397-20	1	X								
1D	Plug Button	T10397-3	1	X								
1E	Thread Forming Screw	S9225-36	1	X								
1F	Lock Washer	E106A-1	1	X								
1G	#10-24 Hex Nut	CF000010	1	X								
1H	1/4-20 Hex Nut	CF000017	1	X								
1I	Lock Nut	T9187-1	1	X								
1J	Output Terminal Assembly	T14166-9	2	X								
1K	1/2-13 Hex Head Flange Nut (Included with item 1J)	T3960	2	X								
1L	Thread Forming Screw	S9225-68	4	X								
1M	Plain Washer	S9262-1	2	X								
1N	Lock Washer	E106A-15	2	X								
1O	1/2-13 x .875 Hex Head Bolt	CF000344	2	X								
1P	Self-Tapping Screw	S8025-65	4	X								
2	P.C. Board Cover	L10804	1	X								
2A	Self-Tapping Screw	S8025-91	4	X								
3	Control P.C. Board Assembly	L8484-[]	1	X								
3A	Self-Tapping Screw	S8025-75	5	X								
3B	Plastic Expansion Nut	S14020-3	4	X								
4	Baffle	G3438	1	X								
4B	Bushing	T12380-6	1	X								
4C	Bushing	T12380-4	1	X								
4D	Universal Bushing	T14614-2	1	X								
4E	Input Cable Grommet	S18543-1	1	X								
5	Thread Forming Screw	S9225-36	1	X								
5A	Plain Washer	S9262-27	2	X								
5B	Lock Washer	E106A-1	1	X								
5C	#10-24 Hex Nut	CF000010	1	X								
6	Lower Case Back	G2546	1	X								
7	Upper Case Back	G2545	1	X								
7A	Input Cable Grommet	S18543-2	2	X								
7B	Bushing	T12380-6	1	X								
7C	Self-Tapping Screw	S8025-91	2	X								
7D	Flat Washer (Not Shown)	S9262-27	1	X								
7E	Hose Clamp (Not Shown)	S24305	1	X								
8	Capacitor	S13490-114	1	X								
8A	Diode Bridge	T13637-1	1	X								
8B	Mounting Bracket	L9250	1	X								
9	Engine Cross Suppot	L10805	1	X								
9A	Battery Support	M16528	2	X								
9B	Tread Forming Screw	S9225-68	6	X								
10	3/8-16 x 1.75 Hex Head Cap Screw	CF000112	2	X								
10A	Plain Washer	S9262-120	2	X								

#

Indicates a change this printing.

* Recommended Spare Part

Use only the parts marked "x" in the column under the heading number called for in the model index page.


ITEM	DESCRIPTION	PART NO.	QTY.	1	2	3	4	5	6	7	8	9
10B	Lock Washer	E106A-14	2	X								
10C	3/8-16 Hex Nut	CF000067	2	X								
11	Rear Base Panel	L10783	1	X								
11A	Fuel Tank Support	M16528	1	X								
11B	Thread Forming Screw	S9225-68	4	X								
12	Base Assembly	L10777	1	X								
13	Stator Support Bracket	L8437	1	X								
13A	Thread Forming Screw	S9225-68	6	X								
13B	Carriage Bolt	T11827-23	2	X								
13C	Plain Washer	S9262-98	2	X								
13D	Lock Washer	E106A-2	2	X								
13E	1/4-20 Hex Nut	CF000017	2	X								

Note: When ordering new printed circuit boards indicate the dash number [] of the "Old" board that is to be replaced. This will aid Lincoln in supplying the correct and latest board along with any necessary jumpers or adapters. The dash number brackets [] have purposely been left blank so as to eliminate errors, confusion and updates.

NOTES

ZR-8

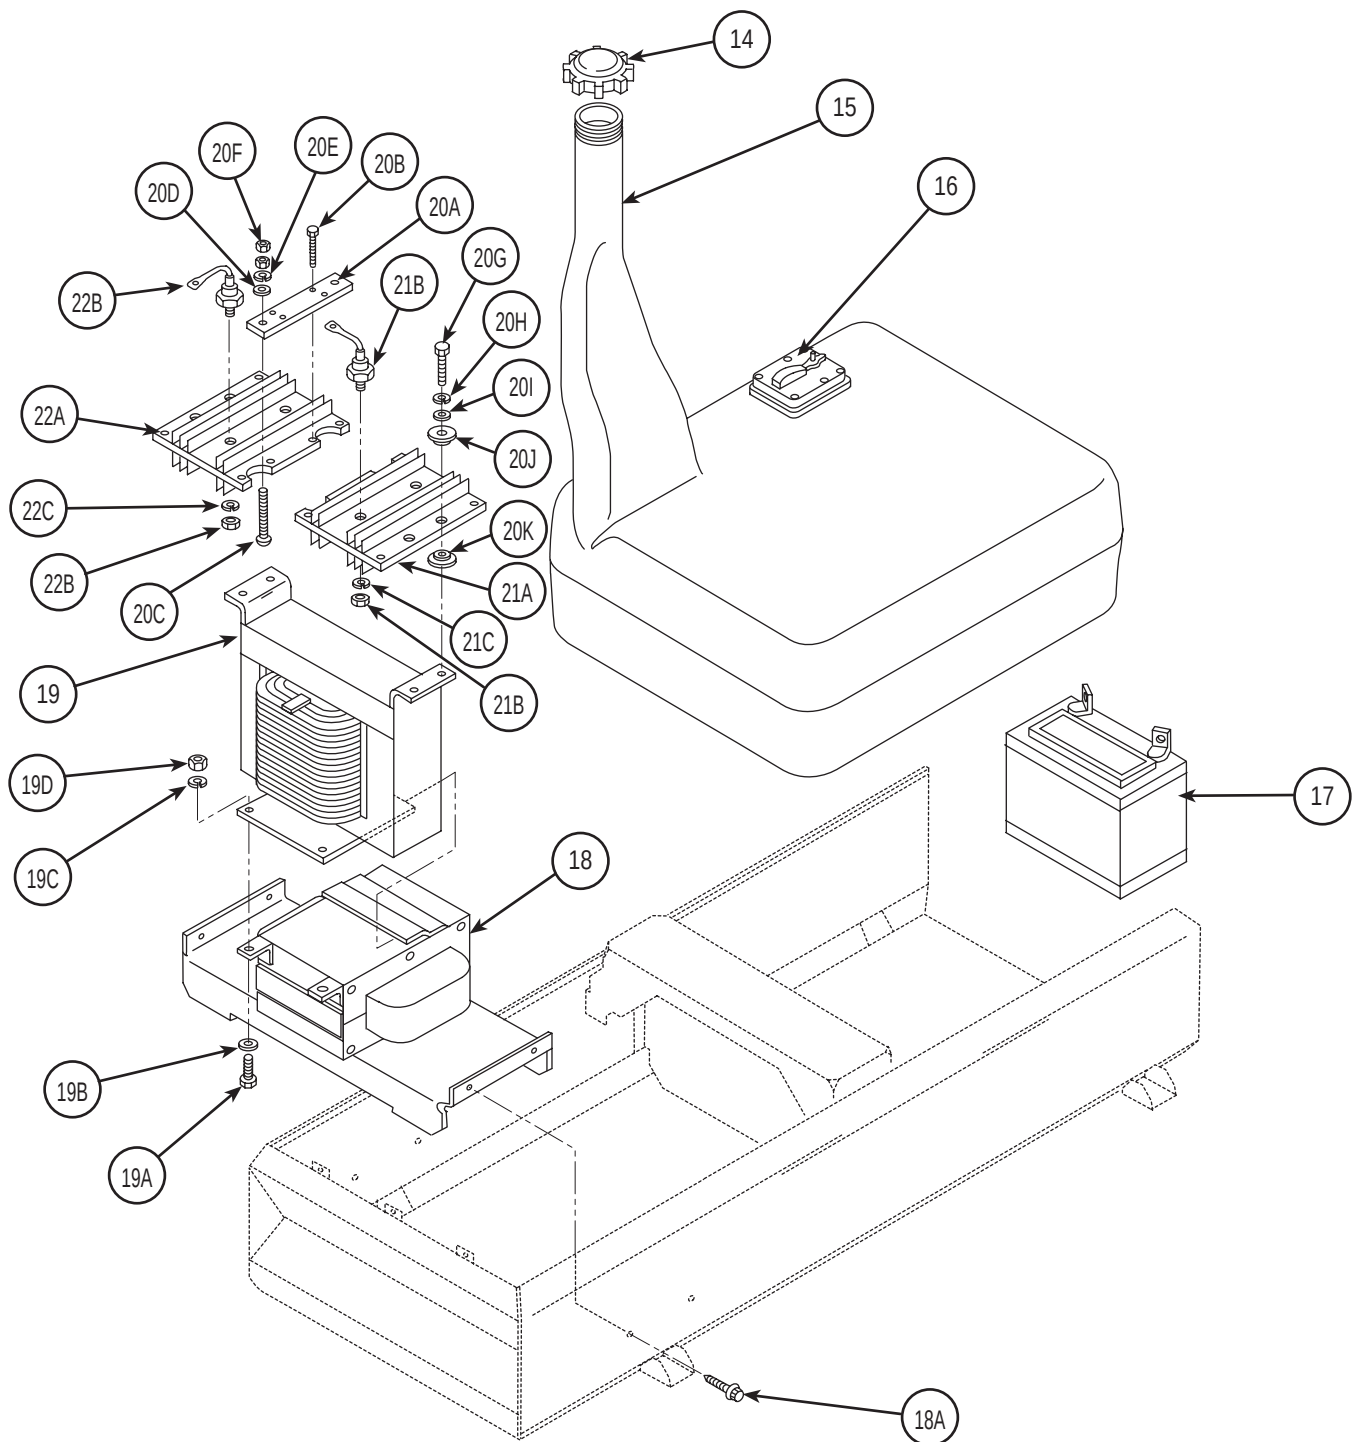

BASE ASSEMBLY (2 of 2)

Indicates a change this printing.

* Recommended Spare Part

Use only the parts marked “x” in the column under the heading number called for in the model index page.

[illegible]

NOTES

ZR-8

